



## **SSM 52196 2020-2022 Aviator, 2021-2022 Corsair - Hybrid Vehicles - Charging Concerns With The Lincoln Dual-Voltage Charging Cord (TurboCord) - Built On Or Before 01-Apr-2022**

Some 2020-2022 Aviator and 2021-2022 Corsair hybrid vehicles built on or before 01-Apr-2022 may exhibit charging concerns with the Lincoln dual-voltage charging cord (TurboCord). This style of charging cord can be identified by one of the 220V prongs positioned sideways. If the vehicle charges properly using a 110/120V non-ground fault interrupter (GFI) outlet with the original 220V adapter removed, replace the adapter (part number VLC5Z-10B706-B) alone. This replacement adapter is available from [accessories.lincoln.com](https://accessories.lincoln.com) > keyword search Turbo Cord, or through the local Ford Authorized Distributor (FAD). Discoloration of the 220V adapter or dual voltage charging cord could indicate a problem with the electrical outlet used; if so a licensed electrician should inspect. For further diagnostic assistance, contact Webasto Charging systems, Inc. directly at 888-219-6747 or at [evscs@webasto.com](mailto:evscs@webasto.com).