



## **SSM 52213 2022-2023 F-150, 2023 F-Super Duty - Please Contact Authorized Dealer For Service Message In The Center Display Screen With Diagnostic Trouble Code (DTC) P0A93:96 In The DCACA**

Some 2022-2023 F-150 and 2023 F-Super Duty vehicles equipped with a direct current/alternating current converter module A (DCACA) inverter (minor feature code HUKAK) may exhibit a Please Contact Authorized Dealer For Service message in the center display screen with DTC P0A93:96 stored in the DCACA. This may be due to the software level of the DCACA and has no effect on vehicle operation. To confirm a vehicle is built with a certain minor feature code, review the build information by double-clicking the vehicle identification number (VIN) in the upper left corner in the Professional Technician System (PTS). To correct this condition, reprogram the DCACA to the latest software level using the latest version of the Ford Diagnosis and Repair System (FDRS) scan tool. For claiming, use causal part 19G317 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.