

Subject: SQUEAKING NOISE FROM REAR OF VEHICLE WHEN DRIVING ON BUMPY ROADS AND TURNING	Bulletin No.: 02-001/24
	Last Issued : 01/30/2024

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
02-004/23	11/08/23

APPLICABLE MODEL(S)/VINS

2024 CX-90 with VINS lower than JM3KK*****152396 (produced before December 2, 2023)


DESCRIPTION

Some customers may complain about squeaking noise coming from the rear of vehicle when driving on bumpy roads and turning. This is caused when the lubricant coating comes out of the bump stopper, changing the resistance between the damper rod and bump stopper. To eliminate this concern, **rubber grease is being added inside the bump stoppers during the production process.**

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Remove both rear bump stoppers according to the instructions in MGSSI (REAR SHOCK ABSORBER AND COIL SPRING REMOVAL/INSTALLATION) and (REAR SHOCK ABSORBER AND COIL SPRING DISASSEMBLY/ ASSEMBLY).
3. Apply rubber grease (0.5-1.0g) inside the bump stopper, principally at the areas indicated in the image below (A).

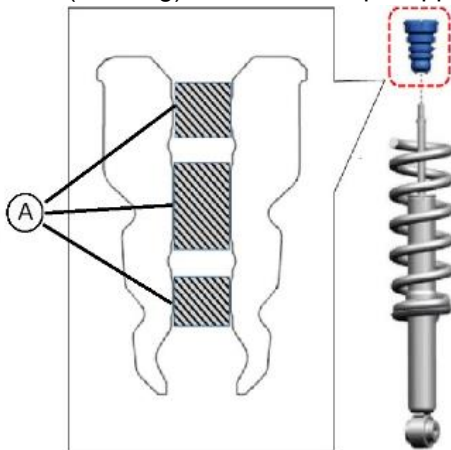

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

4. Install the parts in the reverse order of removal.
5. Verify the repair.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
9YB04-1237	NUT	2	[R]

[R]: Replacement parts

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	99
Part Number Main Cause	KBB6-28-1A1
Quantity	0
Operation Number / Labor Hours:	XXWGECA / 1.4 Hrs. (both sides)

NOTE: Claim nut(s) (9YB04-1237) as related part(s).

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.