

Mack Medium Duty (MMD) Rear Suspension Bump Stop Bending


Published 29 January 2024

Valid For

Mack Medium Duty (MMD)

Model Year 2021-2024

During certain operational scenarios and duty cycles, the rear suspension stamped steel bump stop in Mack MMD trucks with the 21,000lb VOAS rear suspension may bend. If this occurs, the bent bump stop may lead to the suspension bottoming out, causing the leveling valve arm to flip over and preventing the system from airing back up.

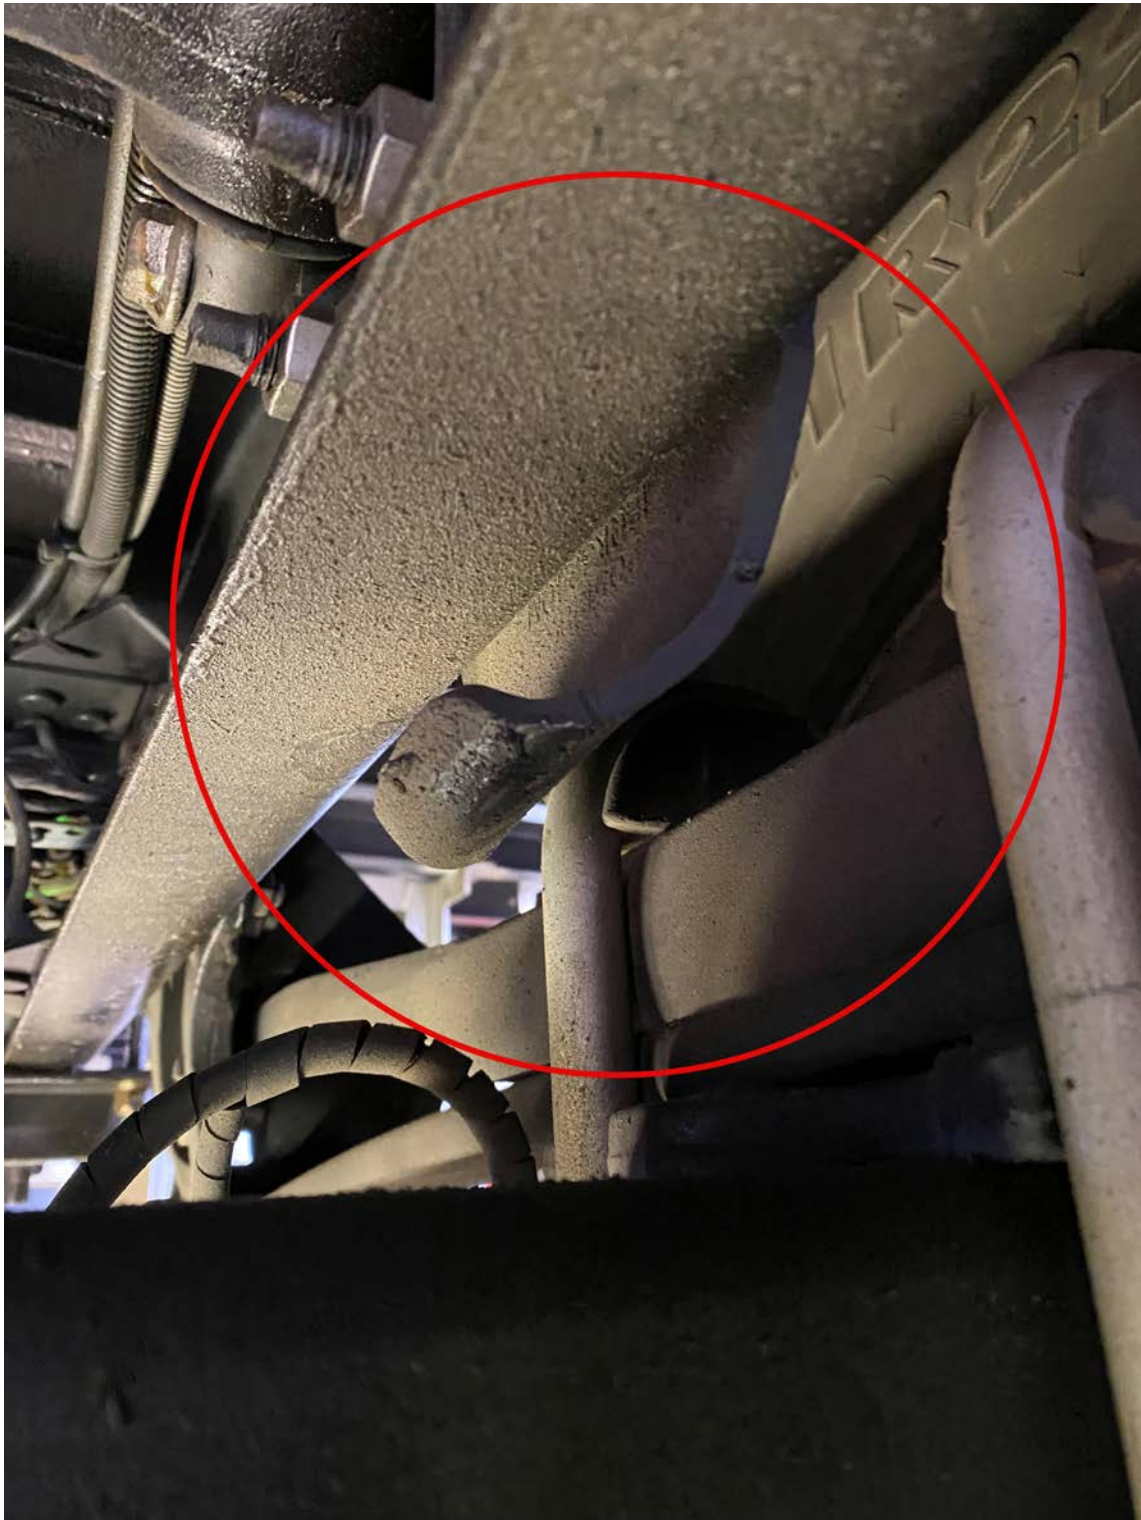

Repair

1. Remove the bent stamped steel bump stop.
2. Install updated class 8 cast bump stop. **P/N 24194608**



Share

to others that might find it helpful

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article