

EDPC Loss of Communication

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Document Information

Location: Electrical

Topic: eDiff warning or Check Engine Light displayed in cluster

Condition: N/A

Diagnostic Trouble Codes: P18A000


Measure

In the event that DTC P18A000 Integrated Power Unit - Unauthorised Tethering in ZC1 is stored and the vehicle has either a Check Engine Light or eDiff warning displayed on the instrument cluster, which could also cause the vehicle start to be inhibited intermittently. Proceed to inspect the EDPC Ground point as shown below.

If found loose then remove the fixing and inspect and clean the contact area. The fixing should then be refitted and torqued to 7nm.

If this ground is not loose, then all other busbar grounds will need to be checked as per KA-01625

Please submit a Technical Request if you have identified this concern along with the above DTC for review.

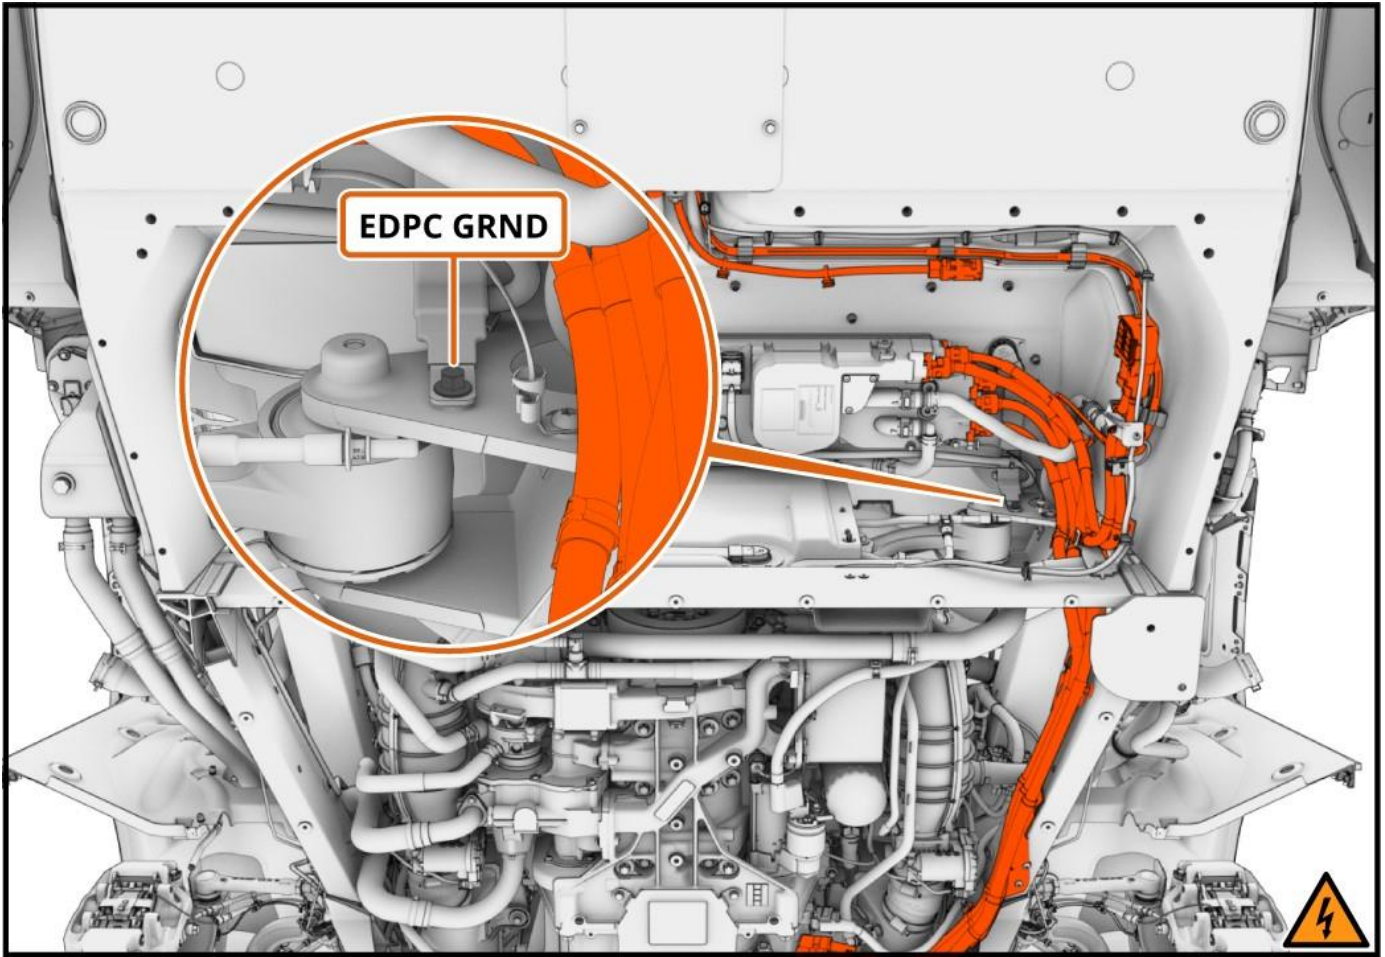

Parts Information

N/A

Attachments

N/A

KA Update Information

24/01/2024 - Initial Release

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.