GLOBAL SAFETY FIELD INVESTIGATIONS DCS6783 URGENT - DISTRIBUTE IMMEDIATELY

Date: February 6, 2024

- Subject: N212350930 Service Update Transmission Control Module Reports Incorrect DTC Permanent Status
- Models: 2021 Chevrolet Corvette
- To: All General Motors Dealers

General Motors is releasing Service Update N212350930 today. The total number of U.S. vehicles involved is approximately 23,538. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated February 6, 2024. Please verify a VIN's involvement by checking in IVH. IVH is the best source for individual VIN inquiries. A Stock VIN list is not included as our records show there are no vehicles in dealer new inventory.

END OF MESSAGE GLOBAL SAFETY FIELD INVESTIGATIONS

Service Update

N212350930 Transmission Control Module Reports Incorrect DTC Permanent Status



Release Date: February 2024

Revision: 00

Attention:	This service update include	s vehicles	in	dealer	inventory	and	customer	vehicles	that	return	to 1	the
	dealership for any reason.											

Involved vehicles will be repaired either through dealer repairs as described in this bulletin or through over the air (OTA) programming. Dealers can and should perform the procedure in this bulletin on any vehicle with an "open" status on the Investigate Vehicle History (IVH) screen in GM Global Warranty Management system. Due to the fact that vehicles will be closed in IVH through successful OTA programming, <u>dealers should always check the status in IVH before performing any vehicle repairs</u>.

		Mode	Model Year		
Make	Model	From	То	RPO	Description
Chevrolet	Corvette	2021	2021		

Involved vehicles are marked "Open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2021 model year Chevrolet Corvette vehicles may incorrectly report to test tools an active permanent status of Transmission Control Module (TCM) Diagnostic Trouble Code (DTC) P2781 (Downshift Switch Circuit High). This could cause the vehicle to not pass an emissions inspection test
	in jurisdictions that check the permanent status of DTCs as part of an emissions testing program.
Correction	Reprogram the TCM with updated software.

Parts

No parts are required for this software update.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9106073*	Verified Module Software or Calibration Level: Module Is	0.2		
	Programmed with Same Level Software or Calibration		ZFAT	N/A
9106074*	Transmission Control Module Reprogramming with SPS	0.5		

Important: * To avoid warranty transaction rejections, carefully read and follow the instructions below:

- The Warranty Claim Code must be accurately entered in the "Warranty Claim Code" field of the transaction.
- When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "Warranty Claim Code field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS/SPS2.

Warranty Claim Code Information Retrieval

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS system as follows:

- 1. Open TIS/TLC on the computer used to program the vehicle.
- 2. Select and start SPS/SPS2.
- 3. Select Settings.
- 4. Select the Warranty Claim Code tab.

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Service Procedure

Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

Note: Carefully read and follow the instructions below.

Service Update

N212350930 Transmission Control Module Reports Incorrect DTC Permanent Status




- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will
 interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to
 www.gmdesolutions.com for further information. If not available, connect a fully charged 12 V jumper or booster
 pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Follow the on-screen prompts regarding ignition power mode, but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

Important: The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.


- For the TLC application, service technicians need to always ensure that the power mode (ignition) is "ON" before
 reading the VIN from the vehicle's VIN master module and that they do not select a VIN that is already in the TLC
 application memory from a previous vehicle.
- If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.
- The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.
- The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.

Caution: Be sure the VIN selected in the drop-down menu (1) is the same as the vehicle connected (2) before beginning programming.

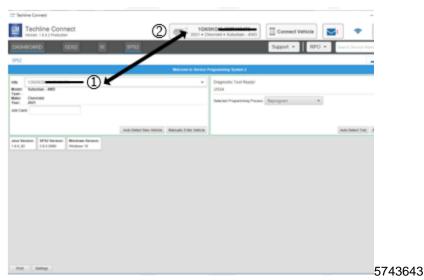

Important: If the vehicle VIN DOES NOT match, the message below will be shown.

Service Update N212350930 Transmission Control Module Reports Incorrect DTC Permanent Status

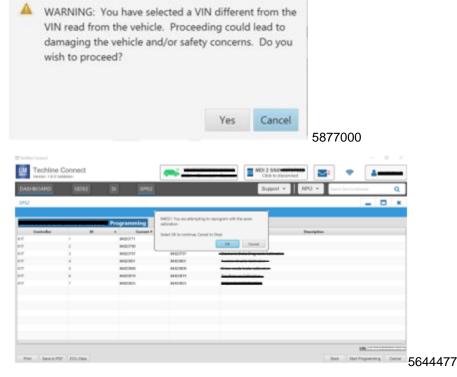

Important: Techline Connect and TIS2WEB screens shown above.

Important: If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

Important: When programming a module in GM's new Vehicle Intelligence Platform, or VIP, the power mode (ignition) needs to be off or errors may occur. This involves the 2020 Chevrolet Corvette, Cadillac CT5 and CT4, full-size Chevrolet, GMC, Cadillac SUVs and Buick Envision. Serial Data Message Authentication also needs to have the ignition off.

1. Reprogram the Transmission Control Module. Refer to K71 Transmission Control Module: Programming and Setup 9750 M3H in SI.

Version: 1.6.0 Vz	Connect		6	Sont - Obernalet -		Click to disconr		2	(1:	-	NUTERTON)
DASHBOARD	GDS2	SI	SPS2			Support *	RPO -	Searc	h Service Man	naels	Q
SPS2									[- 1	- ×
				Warranty Claim	n Code						
Programming Con	aplete.										
VIN -											
			<i>(</i>	<u>ה</u>							
2020-08-19 12:23:4	3 PM	*****		D							
	3 PM			D							
Lo card: 1		>~		D							
Varanty Claim C	ode: 28YN4680855				tor missing W	arranty Claim Code	may result in	rejection	ofwarra	ntv claim	
Warranty Claim C Tao Warranty Claim C	ode: 28YN46808554	to confirm pro		n completed. Incorrect gh "Settings" at SPS st		arranty Claim Codes	may result in	ı rejection	a of warras	nty clain	•
Warranty Claim C Warranty Claim C Warranty Claim C	ode: 28YN46808554	s confirm pro	be retrieved through			arranty Claim Codes	may result it	ı rejectioi	a of warrat	nty clain	
Warranty Claim C Warranty Claim C Warranty Claim C Record this code on	Tode: 28YN46808555 im code is require odes for prior VINo the warranty repair of	s confirm pro	be retrieved through			arranty Claim Codes	may result it	ı rejectioi	a of warrat	nty clain	•
Warranty Claim C No. Warranty Claim C Warranty Claim C Record this code on Post Programming	ode: 28YN4680855 im code is require odes for prior VIN; the warranty repair of Instructions:	order (if applica	be retrieved through			arranty Claim Codes	may result ir	ı rejectioi	a of warran	nty clain	
Warranty Claim C No. Warranty Claim C Warranty Claim C Record this code on Post Programming	Tode: 28YN46808555 im code is require odes for prior VINo the warranty repair of	order (if applica	be retrieved through			arranty Claim Codes	may result ir	ı rejection	a of warrat	nty clain	•
Warranty Claim C The Warranty Claim C Warranty Claim C Record this code on Post Programming Follow the Controlle	code: 28YN46808555 im code is rearrier odds for prior VINs the warranty repair of Instructions: er Specific Instructio	s confirm pro- s serviced may order (if applica ms below.	be retrieved through the best of the best		tart page.	arranty Claim Codes	may result ir	a rejection	a of warrat	nty clain	•

5644478

Note: The screenshot above is an example of module programming and may not be indicative of the specific module that is being programmed. Module selection and VIN information have been blacked out.



Service Update N212350930 Transmission Control Module Reports Incorrect DTC Permanent Status



Important: To avoid warranty transaction rejections, you MUST record the warranty claim code provided on the Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the screen.

2. Record SPS Warranty Claim Code on job card for warranty transaction submission.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Pre-Owned (CPO), courtesy transportation vehicles, dealer shuttle vehicles, CarBravo, etc. in dealers' possession and subject to this field action must be held and inspected/repaired per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Pre-Owned (CPO) vehicles currently in the dealers' inventory within the SHIFT Digital system will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the SHIFT Digital system, or once again be used in the Courtesy Transportation Program.

Dealer Reports - For USA & Export

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

GM bulletins are intended for use by professional technicians, NOT a "<u>do-it-yourselfer</u>". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, <u>DO NOT</u> assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



We Support Voluntary Technician Certification