

The Harley-Davidson Motor Company logo, featuring the word "MOTOR" in a shield, "HARLEY-DAVIDSON" in a rectangular box, and "COMPANY" in a downward-pointing shield, with a registered trademark symbol (®) to the right.

2024-01-26

[illegible]

5. Allow the IFCU to fully boot up and then connect USB-C thumb drive to USB cable.
6. Update will start automatically. Follow prompts shown on the IFCU screen.
 - a. See (Infotainment Control Unit (IFCU) Support Resources) for video.
7. After update is completed, cycle the ignition and repeat Step 1 to confirm Skyline™ OS has updated to (Software version 240002111D).

NOTE

Delete Skyline™ OS folder from thumb drive or use a different thumb drive for the Amplifier software.

8. Unzip Amplifier folder and place file into the root directory of a USB-C thumb drive.
9. Place vehicle into: **Accessory mode**. See owner's manual.
10. Allow the IFCU to fully boot up and then connect USB-C thumb drive to USB cable.
11. Update will start automatically, follow prompts shown on the IFCU screen.
 - a. See (Infotainment Control Unit (IFCU) Support Resources) for video.

Credit Procedure

NOTE

Enter M1625 into comment section of claim.

Submit a warranty claim per Table 4.

Table 4. IFCU and Amplifier Software Update

ITEM	DATA
Claim Type	PRD/MC/DEM - PDI/Standard claim
Problem Part Number	70901090A (DOM) 70901092A (HDI) 70901093A (ROW)
Quantity	Leave blank
Labor Code ⁽¹⁾	1754
Labor Time	0.4 hours
Customer Concern Code	9203
Condition Code	1754
<i>(1) Download may be required</i>	