

**WPH6 - Replacing Air Cleaner Housings and Air Cleaner Cartridges (Workshop Campaign)**

Vehicle Type: **911 Dakar (992)**

Model Year: **As of 2023 up to 2024**

Concerns: **Air cleaner housing**

Cause: **On the affected vehicles, it may happen that the air cleaner cartridges can no longer be installed so that they are airtight, such as when the air cleaners are replaced.**  
 If this is the case, it cannot be ruled out that dirt particles will enter the clean air side of the intake system. As a result, damage to engine components cannot be ruled out.

Action: Replace the air cleaner housing and air cleaner cartridges with a new component status.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

**Required parts**

Part No.	Designation – Location of use	Number
992129567D	⇒ Air cleaner housing with air cleaner cartridge – left	1 piece
992129568D	⇒ Air cleaner housing with air cleaner cartridge – right	1 piece

**Required tools**

- Tool:
- Torque wrench, 2-10 Nm (1.5-7.4 ftlb.), e.g. **V.A.G 1783 - torque wrench, 2-10 Nm (1.5-7.4 ftlb.)**
  - Torque wrench, 6-50 Nm (4.5-37 ftlb.) e.g. **V.A.G 1331A - torque wrench, 6-50 Nm (4.5-37 ftlb.)**
  - Torque spanner, 40-200 Nm (30–148 ftlb.), e.g. **V.A.G 1332A - torque spanner, 40-200 Nm (30-148 ftlb.)**

**Replacing air cleaner housing and air cleaner cartridge**

- Work Procedure: 1 Replace the air cleaner housing and air cleaner cartridges.  
 ⇒ *Workshop Manual '242519 Removing and installing air cleaner housing'*
- 2 Enter the campaign in the Warranty and Maintenance logbook.

**Warranty processing**Scope 1: **Replacing air cleaner housing and air cleaner cartridges****Labor time:**

Replacing air cleaner housing and air cleaner cartridges

Labor time: **297 TU**Includes: Removing and installing rear carrier  
Removing and installing rear apron**Required parts:**

992129567D	Air cleaner housing with air cleaner	1 piece
992129568D	Air cleaner housing with air cleaner	1 piece

⇒ **Damage Number WPH6 066 000 2**

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2024 Porsche Cars North America, Inc.