



# TECHNICAL SERVICE BULLETIN

Classification: DA23-008	Reference: NTB24-002	Date: January 16, 2024
-----------------------------	-------------------------	---------------------------

## DTCS C1B53-04 AND/OR C1B54-04 STORED IN THE ADAS CONTROL MODULE

**APPLIED VEHICLES:** 2019-2023 Kicks (P15)  
**APPLIED SYSTEMS:** Side Obstacle Warning System

### IF YOU CONFIRM

DTCs C1B53-04 for "SIDE RDR R MALF" and/or C1B54-04 for "SIDE RDR L MALF" are stored as CURRENT in the ADAS Control Module.

### AND

The ESM diagnosis leads to Side Radar Sensor replacement.

### ACTION

If replacing one or more affected Side Radar Sensor(s), refer to the **SERVICE PROCEDURE** in this bulletin to apply a strip of foam around each of the Side Radar Sensors before reinstalling the rear bumper fascia.

**HINT:** This bulletin does not cover the diagnosis or replacement of the Side Radar Sensors.

**IMPORTANT:** The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

**IMPORTANT:** The following steps and figures show the passenger (RH) side, the driver (LH) side is similar.

1. Clean the area shown in Figure 1 with isopropyl alcohol.

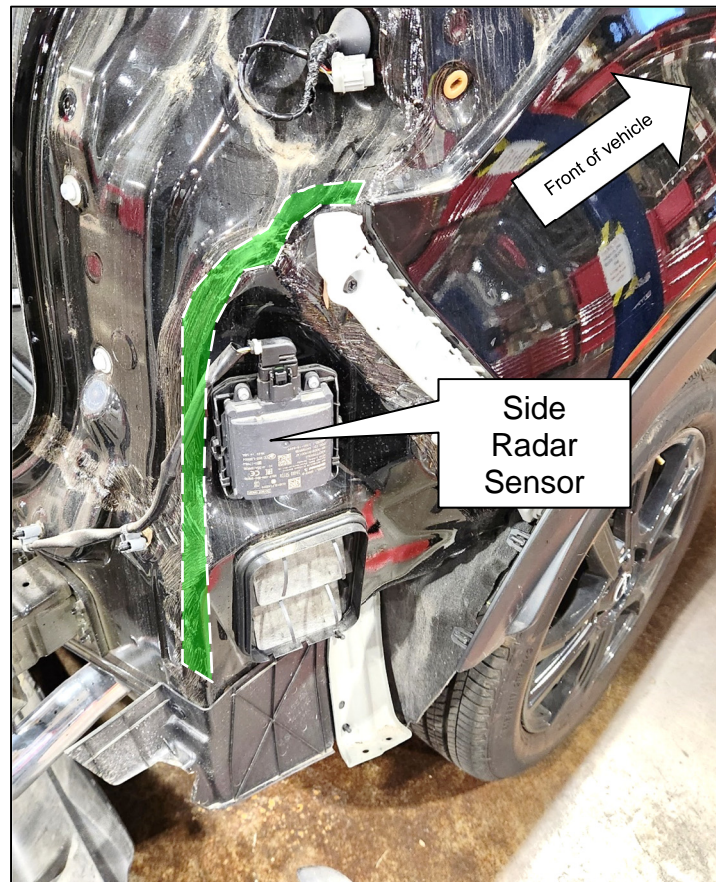


Figure 1

2. Separate the four (4) foam strips from the **PARTS INFORMATION**.



Figure 2

- Using two (2) foam strips, place the foam strips in the locations shown in Figure 3.

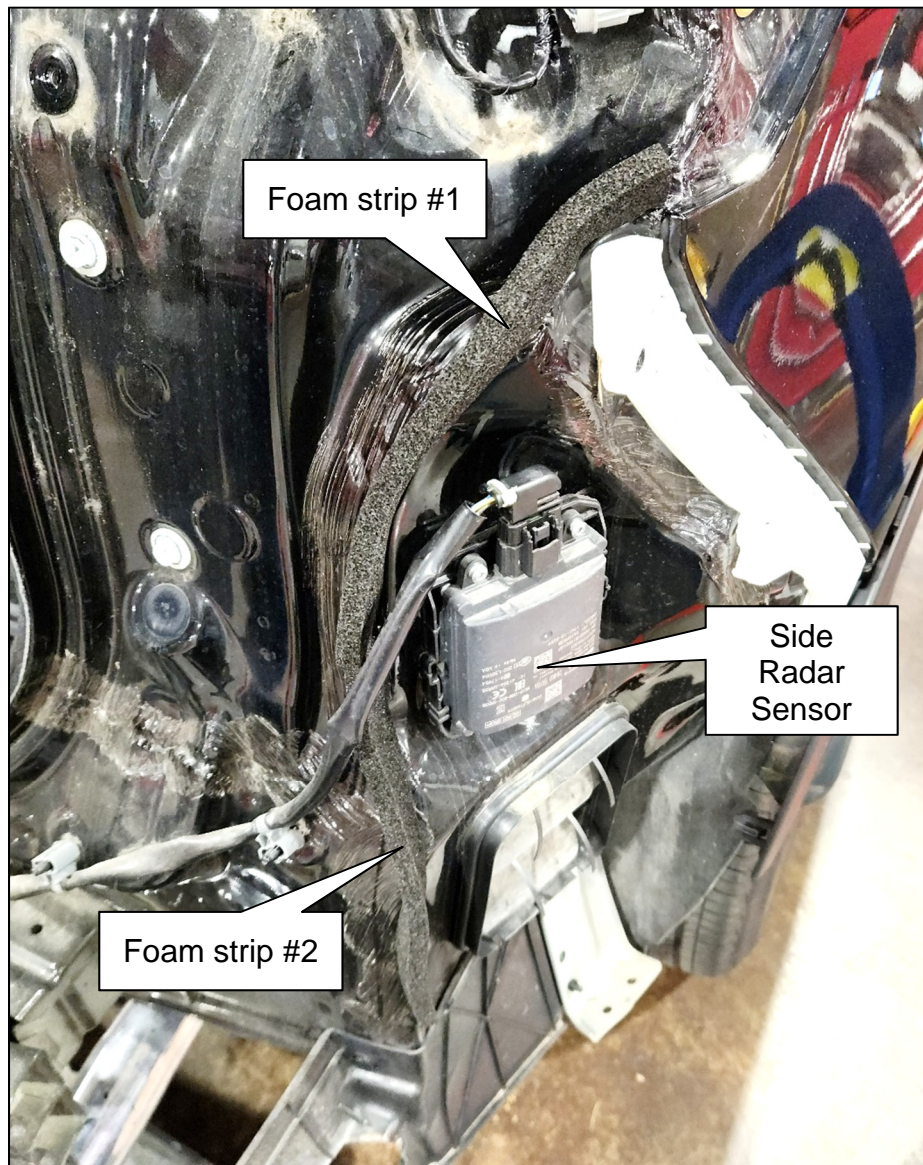


Figure 3

- Repeat steps 1 - 3, starting on page 2 for the driver (LH) side.
- Install the rear bumper fascia.
  - Refer to the **ESM: BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > EXTERIOR > REMOVAL AND INSTALLATION > REAR BUMPER > Removal and Installation**

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
SEAL – INSPECTION HOLE COVER (Foam strips)	74847-5RH0B	1

## CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Apply Foam Side Radar - One	(1)	SX24AA	ZE	32	0.7
Apply Foam Side Radar - Both		SX25AA			

- (1) Reference the electronic parts catalog and use the Sensor Assy Side Obstacle Warning (284K0-\*\*\*\*) as the Primary Failed Part (**PFP**).

## AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
January 16, 2024	NTB24-002	Original bulletin published

