



Technical Service Bulletin

70 Noises from headliner/sunroof area

70 24 87 2038029/9 February 6, 2024. Supersedes Technical Service Bulletin Group 70 number 21-72 dated April 9, 2021 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3 Sportback e-tron	2016 – 2018	All	Not Applicable
A3 Cabriolet	2015 – 2019		
A3, and S3	2015 – 2020		
RS 3	2017 – 2020		
A4, and S4	2010 – 2016		
A4 avant	2010 – 2012		
A4 allroad	2013 – 2016		
A8	2011 – 2017		
S8	2014 – 2017		
Q3	2015 – 2018		
Q5	2010 – 2017		
SQ5	2014 – 2017		
Q7	2010 – 2014		

Condition

REVISION HISTORY		
Revision	Date	Purpose
9	-	Revised header (Corrected model codes and model years, add PR codes) Revised <i>Warranty</i> (Updated SRTs and labor operations)
8	04/19/2021	Revised header (Added MY 2019 – 2020 A3 vehicles)
7	10/31/2019	Revised <i>Service</i> (Change to work process steps, change to required material type, and amount) Revised <i>Warranty</i> (Updated Labor Operations) Revised <i>Required Parts and Tools</i> (Change to required material)

Customer states:



Technical Service Bulletin

- There are various squeaks and/or rattles heard from the roof area on vehicles equipped with a panoramic sunroof.

Technical Background

These noises can be created by the points of contact between the sunroof cover trim frame and the clips that retain it to the headliner.

Production Solution

Not applicable.

Service

1. Carefully unclip the sunroof cover trim frame and lower the headliner (Figure 1). The headliner does not need to be removed.



Figure 1. Unclipping the sunroof cover trim frame.



Technical Service Bulletin

2. The number of retaining clips will vary by model. A piece of dampening tape (webbing adhesive tape D 004350A2) will be applied to each clipping point. Cut pieces of the tape 25mm long (Figure 2).

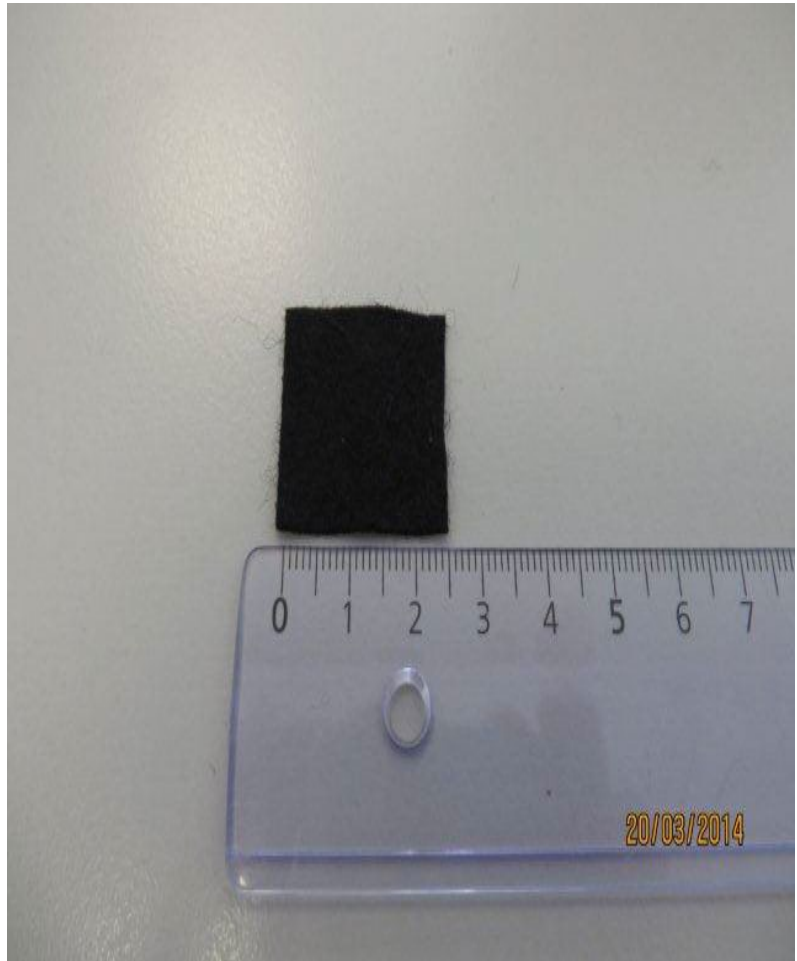


Figure 2. A 25mm section of fleece adhesive tape D 004350A2.



Technical Service Bulletin

3. Apply the sections of webbing adhesive tape to the sunroof cover trim frame to each clipping point as shown (Figures 3 - 4).



Figure 3. Fleece adhesive tape section applied.



Technical Service Bulletin



Figure 4. Retaining clip isolated with the fleece adhesive tape.



Technical Service Bulletin

4. Reassemble the components removed for this modification. Ensure that the glass sliding roof panels are adjusted properly according to the repair manual (Figure 5).

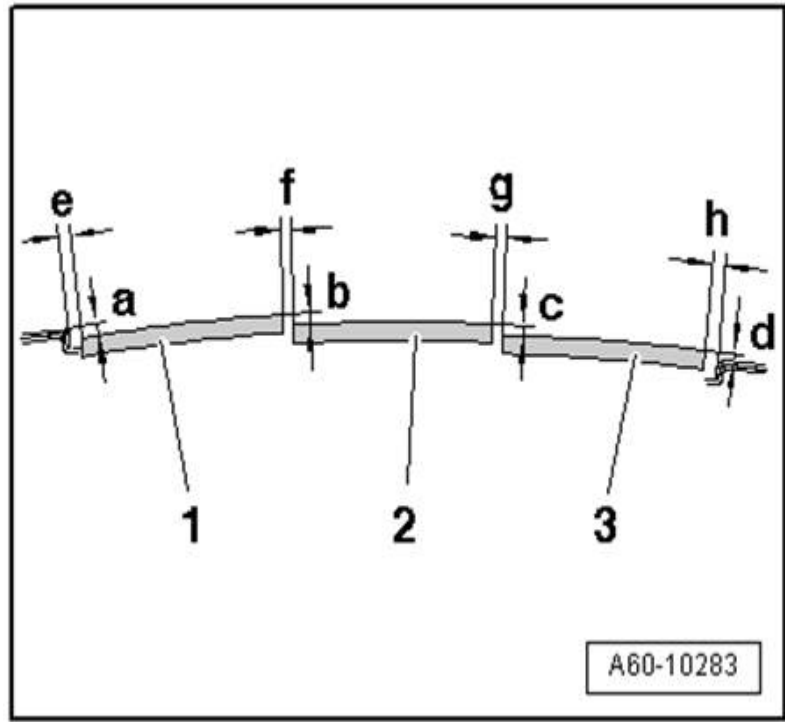


Figure 5. Adjustment of the glass sliding roof panels.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	7084		
Damage Code:	0020		
Labor Operations:	A8L:		
	Front and rear sunroof cover trim frames remove and reinstall and apply fleece adhesive tape	7084 4999	190 TU
	Q7:		
Front and rear sunroof cover trim frames remove and reinstall and apply fleece adhesive tape	7084 4999	220 TU	



Technical Service Bulletin

	A4 Avant/allroad:		
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 4999	110 TU
	Q5:		
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 4999	160 TU
	Q3:		
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 4999	120 TU
	A3 sedan and A3 e-tron:		
Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 4999	110 TU	
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	0121 0002	10 TU
	Road test after the service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2038029/9		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity



Technical Service Bulletin

D 004350A2	 <p data-bbox="329 993 618 1020">Webbing Adhesive Tape</p>	0.1
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA

Additional Information

All parts and service references provided in this TSB (2038029) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.