



Service Bulletin

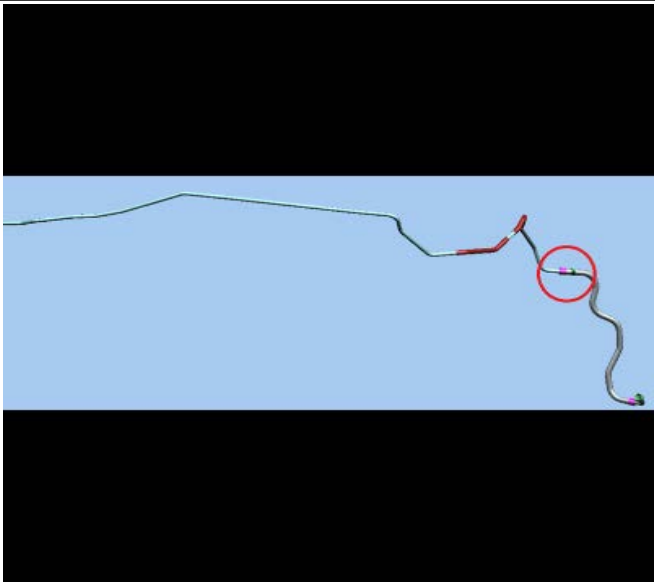
Bulletin No.: 23-NA-207

Date: January, 2024

TECHNICAL

Subject: Ticking, Rattle and/or Buzzing Noise Heard from inside Passenger Side

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro ZL1	2017	2024			LT4	
	Camaro ZL1 1LE						

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Palestine, Argentina (Mercosur), Brazil (Mercosur), Bolivia (West), Chile (West), Colombia (West), Paraguay (West), Peru (West), Uruguay (West), Japan, GM Korea Company, China - SGM, Thailand (ASEAN), Other Africa
Condition	Some customers may comment on a rattle, tick or buzz noise coming from the passenger side. – The noise may be louder inside of the vehicle rather than on the outside.
Cause	 <p style="text-align: right; margin-right: 20px;">6483330</p> <p>This condition may be caused by the fuel feed pipe between the high-pressure fuel pump and chassis fuel line allowing high pressure pulsation back to the low side of the fuel system. – This may be due to a faulty pulse dampener internal to the part.</p>



6483325

Note: There is not a good way to test this pulse dampener. Following the line underneath the vehicle, a sound check can be made in this location indicated in the graphic above, to confirm the noise is present within the fuel line.

If the pulse dampener has been validated to be the cause of the noise, replace the fuel feed pipe.

Correction



6483334

These graphic above shows the location of the chassis fuel feed pipe on the LT4 engine. This line will run along the firewall and below the vehicle. It will have a jumper line with quick disconnects at both ends. One end will connect to the chassis line and the other to the high-pressure pump feed line.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Fuel Feed Pipe Replacement in SI*.

Parts Information

Note: Only select the parts that coincide with the repair performed. Replace the part with the P/N outlined in the Electronic Parts Catalog (EPC) in accordance with the vehicle VIN.

Causal Part	Description	Part Number	Qty
X	PIPE ASM-FUEL FEED	84404473	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4026830	Fuel Feed Pipe Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released January 22, 2024

