



Service Bulletin

Bulletin No.: 24-NA-024

Date: February, 2024

TECHNICAL

Subject: Mobile Phone Inductive Charger Bin Liner Installation Tips

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
GMC	Hummer EV Pickup	2022	2024				
	HUMMER EV SUV	2024	2024				

Involved Region or Country	North America and Middle East
Additional Options (RPOs)	
Condition	Some customers may comment on may remove the rubber liner from the mobile phone inductive charger bin to clean the liner. When trying to re-install the liner, the rubber mounting tabs along the top flange of the liner will not engage with the center console housing thus preventing it from being properly re-installed.
Cause	The cause of the condition may be that the rubber liner was never intended to be removed for cleaning purposes.
Correction	Modify and/or replace the liner shown in the Service Procedure.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Model Year 2022–2023

Note: Reuse of the original liner is not feasible.

Order a new liner and perform the tab removal process before installation.

To aid the re-installation, cut off the top 4 rubber retainers (tabs) from the backside of the liner as shown in Figure 1. By doing so, the liner can easily be reinstalled into the plastic bin.



6537574

Model Year 2024 and Beyond

Important: DO NOT replace the liner.

This model year already is equipped with the updated part.

To aid the re-installation, cut off the top 4 rubber retainers (tabs) from the backside of the liner as shown in Figure 1. By doing so, the liner can easily be reinstalled into the plastic bin.

Verify the top edge of the liner is fully tucked under the door (see figure 2). Close and open the door to verify the liner does not catch on the door.



6537575

Parts Information

Causal Part	Description	Part Number	Qty
X	Rubber Liner	85607336	1

Version	1
Modified	Released February 02, 2024

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION