



Technical Service Bulletin

91 “Night vision assist: fault. Please contact workshop” Warning in Instrument Cluster. DTC U110100
91 24 71 2065980/2 February 15, 2024. Supersedes Technical Service Bulletin Group 91 number 22-76 dated February 8, 2022 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron quattro	2019	All	Night Vision
e-tron Sportback quattro	2020		

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Added DoIP Instruction)
1	02/08/2022	Initial publication

Customer states:

- “Night vision assist: fault. Please contact workshop” is displayed on the instrument cluster.
- Night vision does not work.

Workshop findings:

The following DTC is stored in the Night Vision System Control Module, -J853- (diagnostic address 0084).

- **DTC U11000:** Component protection active.

Technical Background

Software of the Data Bus On Board Diagnostic Interface, -J533- (diagnostic address 0019) needs to be updated.

Production Solution

Updated software of the Data Bus On Board Diagnostic Interface, -J533- (diagnostic address 0019).

Service

1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating.





Technical Service Bulletin

Please activate DoIP in the ODIS settings before updating the Data Bus On Board Diagnostic Interface, J533 (Diagnostic address 0019).

2. Update the software of the Data Bus On Board Diagnostic Interface, J533 (diagnostic address 0019) using the SVM action code as listed in the table below, if necessary:

Diag. Address	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code
19	4K1907468A	322	4K1907468AB	457	19A022
	4K1907468B	319			
	4K1907468E	358			
	4K1907468H	455			
		456			
	4KE907468	362	4K1907468AC		
	4K1907468D	322			
	4K1907468J	455	4K1907468AB		
	4KE907468	362	4K1907468AC		
	4KL907468	362			

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 Up to 48 Months/50,000 Miles. • G10 for CPO Vehicles – Verify Ownership. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9035		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 100 TU)
Diagnostic Time:	GFF	No allowance	0 TU



Technical Service Bulletin

	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2065980/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732: *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (**2065980**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.