

Replacement Requirement for Center Console Support: Observing Special Procedure when Replacing Component (216/23)

Model Line: **Cayenne (9YA)**

Model Year: **2019**

Concerns: **Center console support**

Cause: **The center console support with index B installed in model year 2019 (K) is no longer available.**
 If a new center console support (index D or higher) is required for vehicles from these model years, the cover for the tray (center armrest) must also be replaced. The screw connection for the cover for the tray (center armrest) has been changed from 2 to 4 screw points in the new component status.

Action: If the center console support is required for a replacement, check the number of screw connections on the cover for the tray (center armrest) and

- replace center console support if there are **4 screw points**
- or
- if there are **2 screw points** replace the center console support **and** the cover for the tray (center armrest)

Required parts

Parts Info:	Part No.	Designation - Location	Quantity
	9Y0863241D	⇒ Center console support	1 piece
	N 91205201	⇒ Cheese head bolt with multiple-tooth head (instrument cluster) - Seat rail on body	8 pieces

Additional parts required if the cover for the tray (center armrest) needs to be replaced:

See information*	⇒ Cover (center armrest) - Center console package cover	1 piece
PAF91219101	⇒ Countersunk screw with internal serration, M8 x 26 - Screws on center armrest cover	4 pieces

**Information**

*

The cover for the tray (center armrest) provided in the Porsche spare part catalogue (PET2) based on the vehicle ID no. corresponds to the previous component status and is **not** compatible with the new center console support.

The work procedure for determining the appropriate part number is described using an example in the section "Replacing center console carrier and, if necessary, cover for the tray (center armrest)".

Required tools

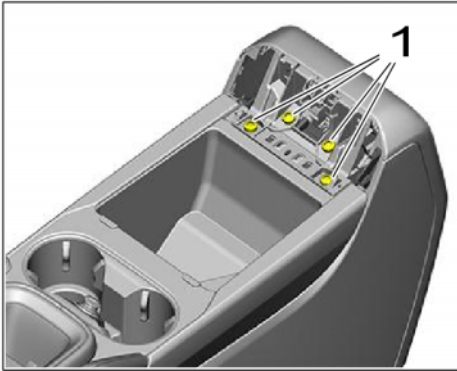
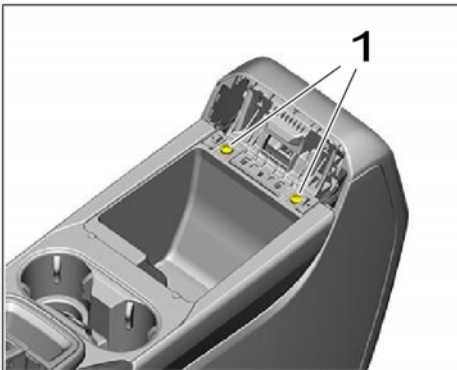
Tools:

- **P90999 - PIWIS Tester 4**
- Battery charger with a current rating of **at least 90 A**, e.g., **VAs 5908 battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charging vehicle electrical system and battery'*
- Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g., **V.A.G 1783 - torque wrench, 2-10 Nm (1.5-7.5 ftlb.)**
- Torque wrench, 20-100 Nm (15-74 ftlb.), e.g., **VAS 5820 - torque wrench, 20-100 Nm (15-74 ftlb.)**
- Torque wrench, 40-200 Nm (30-148 ftlb.), e.g., **V.A.G 1332A - torque wrench, 40-200 Nm (30-148 ftlb.)**

Replacing center console support and, if necessary, cover for the tray (center armrest)

- Work Procedure: 1 Open cover for the tray (center armrest).
- 2 Unclip cover ⇒ *Cover -1-* using a suitable tool ⇒ *Cover -Arrows-*.
- 3 Check the number of screw connections on the cover for the tray (center armrest).

*Cover*

Assessment	Action
<p>There are 4 screw points ⇒ <i>New component status -1-</i>.</p>  <p><i>New component status</i></p>	<p>Replace center console support. For procedure, see: ⇒ <i>Workshop Manual '68171900 Removing and installing centre console'</i></p> <p>End of action.</p>
<p>There are 2 screw points ⇒ <i>Previous component status -1-</i>.</p>  <p><i>Previous component status</i></p>	<p>Determine part number for cover for the tray (center armrest) and finally replace center console support and cover for the tray (center armrest).</p> <p>Continue with Step ⇒ 4.</p>

4 Determine the part number of the new cover for the tray (center armrest).



Information

The work procedure is described using a sample vehicle; the part numbers shown may differ if necessary.

- 4.1 In the Porsche spare part catalogue (PET2), identify and call up the vehicle with the vehicle ID no.
- 4.2 Then find the cover for the tray (center armrest) provided in the Porsche spare part catalogue (PET2) (Figure 809 - 040).

Labor position and PCSS encryption

Labor position:

APOS	Labor operation	I No.
68171900	Removing and installing center console	

PCSS encryption:

Location (FES5)	68170	Center console
Damage type (SA4)	9744	part not available

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2024 Porsche Cars North America, Inc.