



Technical Service Bulletin

35 Gearbox Malfunction Warning, DTC, P176F00, P176E00, P175E00, P175D00 in the TCM
35 24 49 2073330/1 March 13, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, and A3 Cabriolet	2017 - 2018	All	Not Applicable
S3	2018		

Condition

Customer states:

- Gearbox warning indicated in instrument cluster.

Workshop findings:

One or more of the following DTC(s) may be logged in the transmission control module (TCM), -J217- (address word 0002):

- **DTC P175E00** (clutch 1 closes unintentionally)

And/or

- **DTC P176F00** (clutch 2 closes unintentionally)

And/or

- **DTC P176E00** (clutch 2 opens unintentionally)

And/or

- **DTC P175D00** (clutch 1 opens unintentionally)

Various other DTCs may also be logged with the above DTCs in the transmission control module (TCM), -J217- (address word 0002).

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

One or several of the following DTCs can be logged in the diagnosis log in address word 0002 - gearbox electronics. Please watch out for symptom and fault type 2 as well as the frequency.




Technical Service Bulletin

DTC	Symptom Code	Fault Type 2	Frequency
P175E00 clutch 1 closes unintentionally	10747	passive/sporadic	maximum 2
P176F00 clutch 2 closes unintentionally	10748	passive/sporadic	maximum 2
P176E00 clutch 2 opens unintentionally	10694	passive/sporadic	maximum 2

If the above DTCs match exactly in symptom and fault type 2 and have a maximum frequency of 2 in the diagnosis log, delete all DTCs in address word 0002 - gearbox electronics. Reassess the complaint and check whether the DTC is logged again.

If the complaint is gone, no further repairs are necessary.

 NOTICE
<p>If the above DTCs do not match exactly in symptom, fault type 2, and frequency, this TSB does not apply. Proceed according to the Guided Fault Finding.</p>

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	3511		
Damage Code:	0010		
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2073330/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information



Technical Service Bulletin

All part and service references provided in this TSB (**2073330**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.