

# Technical Service Bulletin

## 90 Front camera for driver assist systems R242 fails to calibrate

90 24 80 2059971/2 March 8, 2024. Supersedes Technical Service Bulletin Group 90 number 20-56 dated July 2, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, and A7	2019 – 2020	All	Front camera for driver's assist systems.
A6 allroad, S6, and S7	2020		

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>service</i> (adapted procedure not to apply to newer part numbers)
1	07/02/2020	Initial publication

### Customer states:

- No customer concerns, it is found during PDI or any other diagnostic work.

### Workshop findings:

- The front camera for driver assist systems R242 has to be removed and reinstalled or replaced.

Or

- The windscreen is replaced.

Or

- The front camera for driver assist systems R242 cannot be calibrated.

### NOTICE


The replacement of the front camera or windscreen is not a part of this TSB.

## Technical Background

There is a deviation in the mounting of the front camera for driver assist systems R242.

## Production Solution

Not applicable.

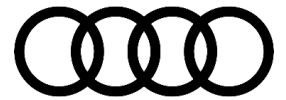

# Technical Service Bulletin


---

## Service

1. Remove any adhesive residues from the front camera, as adhesive may have been used for securing it in the holder.




**Tip: Protect the front camera against damage when removing the adhesive residues.**

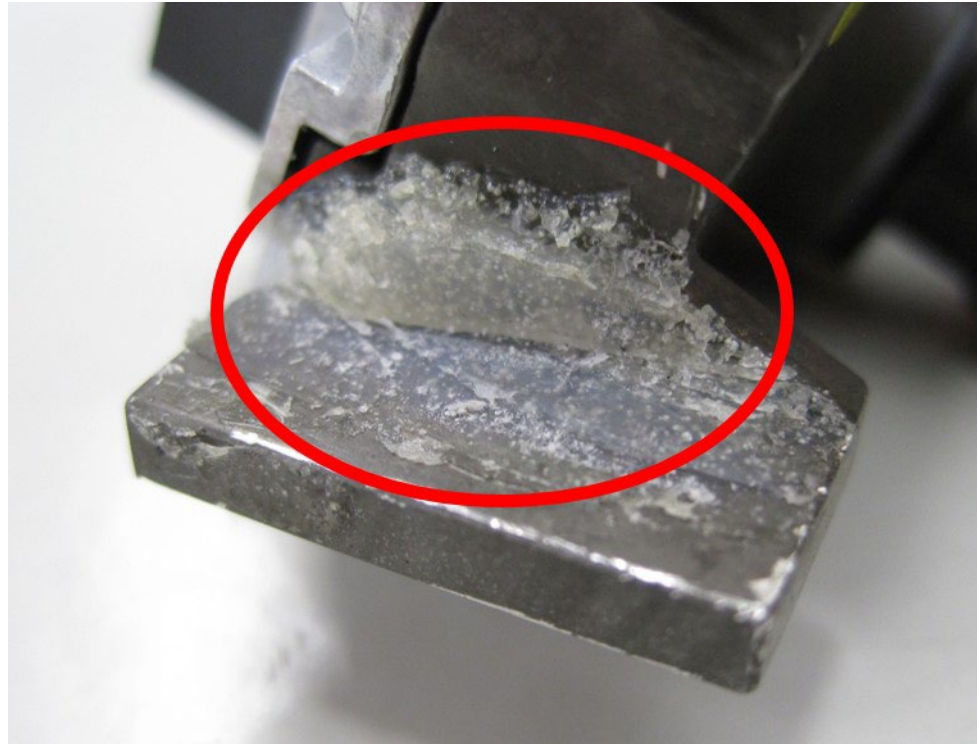

*Figure 1. Cleaning of the camera.*

**Depending on the windshield proceed as follows:**

A6 windshield with part number 4K0 845 099 A / B / F / G / H / J or A7 windshield with part number 4K8 845 099 B / K / L / F:

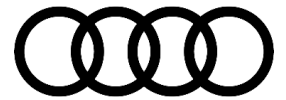


# Technical Service Bulletin


---

2. An aluminum foil (part number 4K0 907 231 MTR) has to be attached to the windshield to correct the pitch angle of the front camera. Manufacture a 5mmx10mm decal and stick it on the mounting bar of the front camera previously cleaned with Isopropanol (Figure 2 and 3).



 *Figure 2. Placement of decal.*

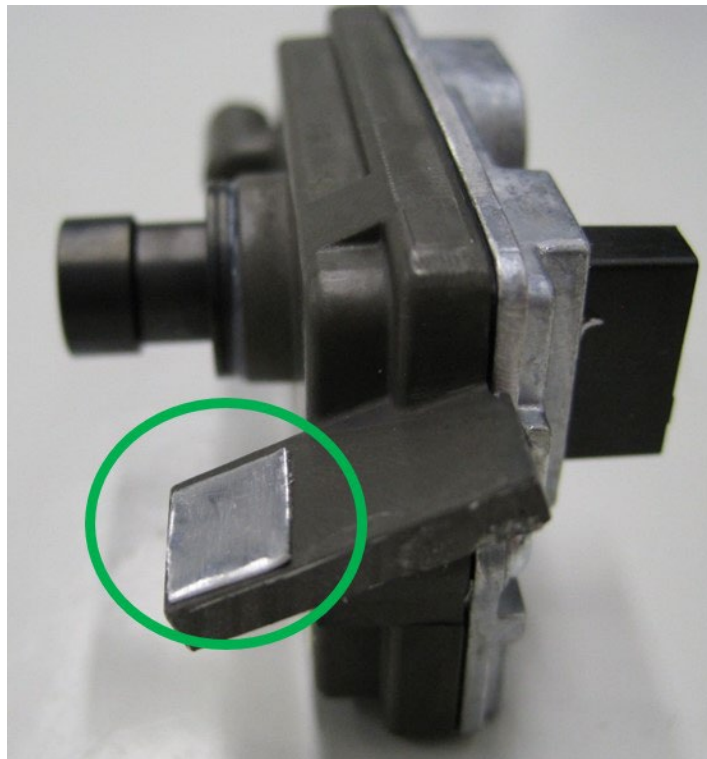



# Technical Service Bulletin

**Figure 3. Placement of decal.**

All other part numbers:

- If this windshield is installed, a correction of the pitch angle of the front camera with aluminum foil is not necessary. An optimized mount for the front camera on the windshield is already installed. If there is aluminum foil on the front camera, it must be removed.

## Warranty


<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>110 up to 48 Months/50,000 Miles.</li> <li>G10 for CPO Covered Vehicles – Verify Owner.</li> <li>If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9638		
<b>Damage Code:</b>	0010		
<b>Labor Operations:</b>	Clean front camera for assistance systems	9638 2999	10 TU
	Modify front camera for assistance systems	9638 4999	10 TU
<b>Diagnostic Time:</b>	GFF	0150 0000	Time stated on the diagnostic protocol (Max 25 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2059971/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All part and service references provided in this TSB (**2059971**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property

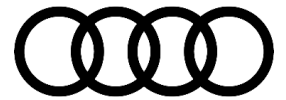

# Technical Service Bulletin

---

rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.