



Preliminary Information

PIT6002A DTC U1521 After Replacing The Headlamp With (TSH or T26) Adaptive Forward Lighting System

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2008 - 2017	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	(TSH or T26) Adaptive Forward Lighting
Condition	DTC U1521 After Replacing The Headlamp With (TSH or T26) Adaptive Forward Lighting.
Cause	The replacement lamp assemblies no longer have the lamp module attached.

Correction:

If you get an Enclave with (TSH or T26) where the headlamp has been replaced and you get dtc U1521.

Check to see that the lamp module was swapped off the old lamp assembly or the lamp will not work. The module is not available through parts so If it wasn't swapped off the old lamp, see if the old lamp assembly is available and swap the module.

If the old lamp assembly is not available, attempt to procure locally.

Note: When replacing the passenger side lamp with a new lamp and after swapping the module, the Adaptive feature will not work. Please keep the module with the new passenger lamp while engineering is working on a correction.

Service engineering is working on correction.

This PI will be updated when more information is available.

Version History

Version2	
Modified	04/17/2023 - Created. 2/1/2024 Updated to add note to correction.



GENERAL MOTORS