



Preliminary Information

PIT6103A Intermittent Power Windows Inoperative - Side Object Detection Indicators On - U1502 and/or U1503 Stored

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer EV	2024	All	All	All	All
Chevrolet	Colorado	2023	All	All	All	All
GMC	Canyon	2023	All	All	All	All


Involved Region or Country:	North America
Condition:	<p>The front and/or rear windows are inoperative, service door latch message, side object detection indicator may be on at all times or inoperative, mirrors may be inoperative, rear door ajar message may be on at all times or inoperative.</p> <p>This concern may be intermittent depending on battery voltage and temperature.</p> <p>If the battery voltage is below 14.8 or the vehicle is warm the windows may work.</p> <p>Codes U0215, U0216, U0217, U0218, U1502, U1503 may be found .</p>
Cause:	Possible defective diode in one or more of the power window switches.

Correction:

Inspect the parts label on all 4 window switches. All switches need to be inspected as this can be just one up to all four switches involved. Do NOT replace any switches outside these breaks. See example part label below for date code location.

Replace Window Switch IF Date Code is:

Vehicle	Driver	Passenger	Rear
Blazer EV	3245 or Lower	3266 or Lower	3266 or Lower
Colorado / Canyon	Between 3156 and 3266	Between 3156 and 3266	Between 3156 and 3266

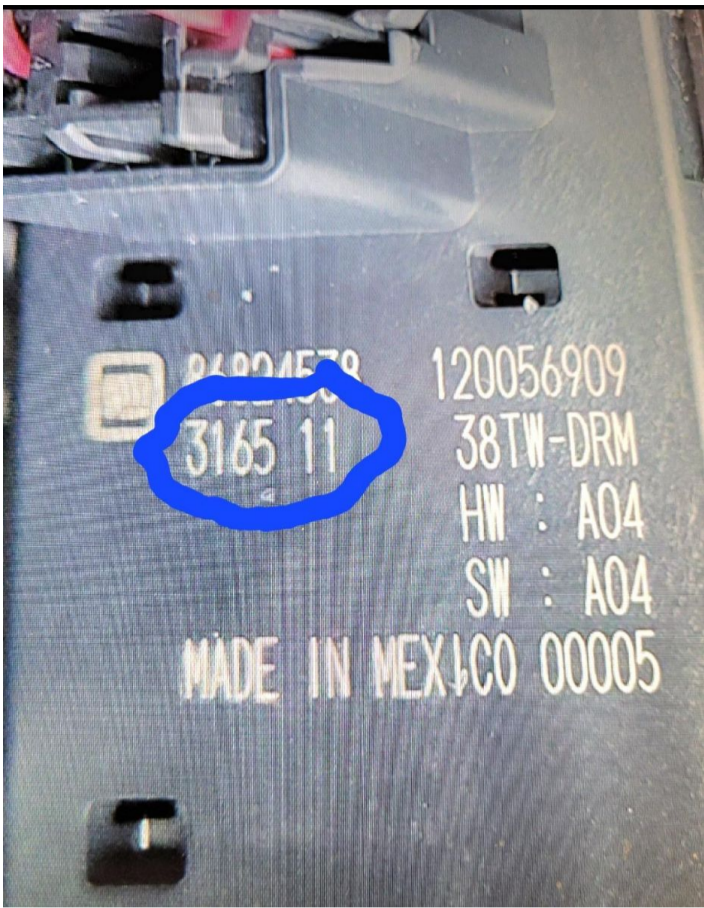

Warranty Information

For vehicles covered under the Bumper To Bumper Warranty please use published labor times.

Version History

Version	2
Modified	12/13/2023 - Created on. 02/23/2024 - Updated date codes and combined Blazer EV document.

