

Bulletin No.: PIP5964 Published date: 02/23/2024

Preliminary Information

PIP5964 No Start, Stalling, Rough Idle, No Acceleration, Loss of Power, Erratic Shifting, Fuel Gauge Inoperative/Erratic, Malfunction Indicator Lamp (MIL) Illuminated - Multiple DTCs Set

<u>Models</u>

Brand:	Model:	Model	VIN:		Engine:	Transmissions:
Brand.	Widdel.	Years:	from	to	Lingine.	
Buick	Enclave	2021 - 2023	All	All	All	All
Buick	Encore	2021 - 2023	All	All	All	All
Buick	Encore GX	2021 - 2023	All	All	All	All
Buick	Envision	2021 - 2023	All	All	All	All
Cadillac	Escalade	2021 - 2023	All	All	All	All
Cadillac	XT4	2021 - 2023	All	All	All	All
Cadillac	хт5	2021 - 2023	All	All	All	All
Cadillac	хтб	2021 - 2023	All	All	All	All
Chevrolet	Blazer	2021 - 2023	All	All	All	All
Chevrolet	Camaro	2021 - 2023	All	All	All	All
Chevrolet	Equinox	2022 - 2023	All	All	All	All
Chevrolet	Express	2021 - 2023	All	All	All	All
Chevrolet	Malibu	2021 - 2023	All	All	All	All
Chevrolet	Silverado 1500 Limited (RPO J21, 12th VIN Digit = 4 or less)	2022	All	All	All	All
Chevrolet	Silverado 1500 New (RPO J22, 12th VIN Digit = 5 or greater)	2022	All	All	All	All
Chevrolet	Silverado 1500	2023	All	All	All	All
Chevrolet	Tahoe	2021 - 2023	All	All	All	All
Chevrolet	Traverse	2021 - 2023	All	All	All	All

Brandi	Model:	Model Years:	VIN:		Engine	Tronomiosioner
Brand:			from	to	Engine:	Transmissions:
GMC	Acadia	2021 - 2023	All	All	All	All
GMC	Savana	2021 - 2023	All	All	All	All
GMC	Sierra 1500 Limited (RPO J21, 12th VIN Digit = 4 or less)	2022	All	All	All	All
GMC	Sierra 1500 1500 New (RPO J22, 12th VIN Digit = 5 or greater)	2022	All	All	All	All
GMC	Sierra 1500	2023	All	All	All	All
GMC	Terrain	2021 - 2023	All	All	All	All
GMC	Yukon	2021 - 2023	All	All	All	All
North America, Europe, Kazakhstan, Uzbekistan, Russia, Middle East, Israel, Palestine, Argentina (Mercosur), Brazil (Mercosur), Bolivia (West), Chile (West), nvolved Region or Country Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Uruguay (West),						

Involved Region or Country	Palestine, Argentina (Mercosur), Brazil (Mercosur), Bolivia (West), Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Uruguay (West), Japan, Cadillac Korea (South Korea), GM Korea Company, Thailand (ASEAN), Australia/New Zealand, Other Africa
Condition	Some customers may comment on one or more of the following conditions: • No Start • Stalling • Rough Idle • No Acceleration • Loss of Power • Erratic Shifting • Fuel Gauge Inoperative/Erratic • MIL Illuminated Technicians may find multiple DTCs set in the Engine Control Module (ECM) including but not limited to: • P129F • P023F
Cause	This condition may be caused by an internal short in the K111 Fuel Pump Driver Control Module (FPDCM)

Follow published diagnostics for the symptoms and/or codes.

If diagnostics does not lead to a cause and any of the above conditions have been validated, replace the K111 FPDCM.

Parts Information

Description	Part Number	Quantity
MODULE ASM-F/PMP PWR CONT	13554821	1
MODULE ASM-F/PMP PWR CONT	13554820	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time		
4022020	Fuel Pump Power Control Module Replacement	Use the Published Labor		
4022020	ruel rump rower control Module Replacement	Operations Time		
*This is a unique Labor Operation for Bulletin use only.				
Important: Warranty coverage code E2 applies for this module, is covered for 8 years/80,000 miles (U.S.) or 8 years/130,000 km (Canada).				

Version History

Version	1
Modified	02/23/2024 - Created on.



© 2024 General Motors. All Rights Reserved.