



Preliminary Information

PIT6055B HUMMER EV Service Driver Assist Message with DMS DTC: U3000 or B0126

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
GMC	HUMMER EV	2022 - 2024	All	12/11/2023	All	All
GMC	HUMMER EV SUV	2024	All	12/11/2023	All	All

Involved Region or Country	North America
Condition	<p>A customer may comment of a "Service Drivers Assist" message, upon inspection one or more of the following DTC's may be found in the K180 Drivers Monitoring System Module (DMSM).</p> <p>B0126 SYM 49 Current/History, U3000 SYM 44 Current/History, U3000 SYM 49 Current/History.</p> <p>Note: If you experience a Service Drivers Assist" message that does not have one of the following DTC's above, refer to normal SI diagnosis.</p>
Cause	Software Anomaly

Correction:

Reprogram the K180 Drivers Monitoring System Module (DMSM) to the latest software released in SPS.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2810865	K180 Driver Monitoring System Control Module Reprogramming with SPS	Use Published Time

Version History

Version	3
Modified	09/12/2023 - Created on. 11/14/2023- Update PI to add software fix that is now available. 02/29/2024- Reinstated PI per request of the Brand Quality Manager.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.