

70 Noises from headliner/sunroof area

70 24 89 2044417/11 March 13, 2024. Supersedes Technical Service Bulletin Group 70 number 24-86 dated January 30, 2024 for reasons listed below.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment | |
|--|----------------------------|-----------|----------------------------|--|
| Q7 | 2017 - 2025 | All | | |
| A4, and A4 allroad | 2017 - 2024 | | | |
| S4 | 2018 - 2024 | | | |
| A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, and S5 Sportback | 2018 - 2023 | | | |
| RS 5 | 2018 - 2019 2021 - 2023 | | Not Applicable | |
| A6, A7, and Q8 | 2019 - 2024 | | | |
| RS 5 Sportback | 2019 2021 - 2023 | | | |
| SQ7 | 2020 - 2025 | | | |
| A6 allroad, S6, S7, SQ8, and RS Q8 | 2020 - 2024 | | | |
| A7 e quattro | 2020 - 2021 | | | |
| RS 6 Avant, and RS 7 | 2021 - 2024 | | | |

Condition

| REVISION HISTORY | | |
|------------------|------------|---|
| Revision | Date | Purpose |
| 11 | - | Revised Warranty (Updated claim types) |
| 10 | 01/30/2024 | Revised Header (Add models and model years) |



| | | Revised Warranty (Updated Labor Ops) |
|---|------------|--------------------------------------|
| 9 | 04/25/2023 | Revised Warranty (Updated Labor Ops) |

Customer states:

• A rattle is heard from the headliner area.

Technical Background

The noises can be caused by movement in the clips that attach the headliner to the sunroof frame or movement between components of the sunroof frame.

Production Solution

Felt material has been added to points of contact in production.

Service

1. Test drive the vehicle (preferably with the customer) and duplicate the noise. Applying pressure to areas of the headliner around the perimeter of the sunroof will eliminate the noise, confirming the root cause.



2. Remove the headliner. The clips shown in the illustration will need webbing adhesive tape (D 004350A2) (Figure 1).



Figure 1. Location of the headliner to sunroof frame clips.

3. Remove the clips and apply the webbing adhesive tape underneath them, as shown (Figure 2).

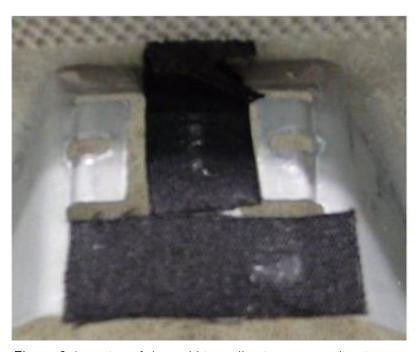


Figure 2. Location of the webbing adhesive tape application.



4. Reinstall the clips (Figure 3).



Figure 3. Clips reinstalled.

5. Apply webbing adhesive tape to the sunroof frame lip at each clipping point (Figure 4).

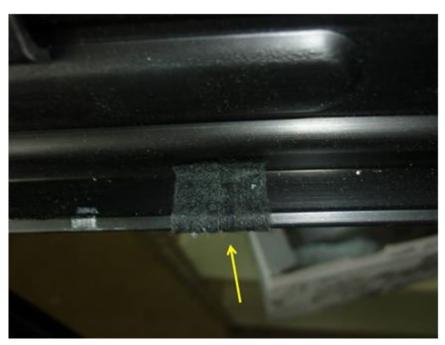


Figure 4. Application area on sunroof frame area of clip engagement.



6. There are two additional points of contact at the front sunroof frame plates that could be a source for noise (Figure 5).



Figure 5. Areas of the sunroof frame to be isolated with webbing adhesive tape.

7. Apply webbing adhesive tape between the sections of the sunroof frame plates on both the right and left sides as shown in the illustration (Figure 6).



Figure 6. Webbing adhesive tape applied between the side and front sunroof frame plates.

8. Perform a final test drive to confirm that the noise has been eliminated.

Warranty



| Claim Type: | 110 Up to 48 Months/50,000 Miles. If the vehicle is outside of any warranty, this Technical Service Bulletin is | | | |
|-------------------|--|--------------|------------------------------------|--|
| | informational only. | | | |
| Service Number: | 7084 | | | |
| Damage Code: | 0020 | | | |
| Labor Operations: | Headliner remove + reinstall | 7084 09XX | See SRT with associated operations | |
| | -OR- | | | |
| | Headliner remove + reinstall | 7084 19XX | See SRT with associated operations | |
| | Apply fleece tape to headliner clips and sunroof frame plates | 7084 2499 | 30 TU | |
| Diagnostic Time: | GFF | No allowance | 0 TU | |
| | Road test prior to the service procedure | 0121 0002 | 10 TU | |
| | Road test after the service procedure | 0121 0004 | 10 TU | |
| Claim Comment: | As per TSB 2044417/10 | | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

| Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. | | |
|---|------------------|----------|
| Part Number | Part Description | Quantity |



| D 004350A2 | Webbing Adhesive Tape | 0.1 |
|------------|---|-----------|
| See ETKA | Fasteners, Bolts, Nuts, and Screws as needed per the Repair | See |
| | Manual | ETKA/ELSA |

Additional Information

All parts and service references provided in this TSB (2044417) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.