



Technical Service Bulletin

96 Traffic sign dependent speed limit setting defaults to "On" after ignition cycle

96 24 94 2073371/1 March 14, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q4 e-tron, and Q4 Sportback e-tron	2024	All	Not Applicable

Condition

Customer states:

- The Traffic sign-dependent speed warning setting automatically defaults to audible warning at 1mph over the speed limit on every ignition cycle.
- A warning tone can be heard every time the speed limit is exceeded by one mph or more.



Figure 1: Traffic sign-based speed warning default settings.



Technical Service Bulletin

Workshop findings:

- No Relevant DTCs are stored.

Technical Background

A bug in the ZDC causes this complaint.

Production Solution

New Target Data Container (ZDC) update in the Front Camera, -R242- (address word 00A5) addressed the condition.

Service

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the Front Camera -R242- (address word 00A5) using the SVM action code as listed in the table below, if necessary:

Model	Old Target Data Container Number	Old Target Data Container Version	New Target Data Container Number (or higher)	New Target Data Container Version (or higher)	SVM Code Input
Q4	89A909466E	0026	89A909466E	0027	A5A021
	89A909466K	0005	89A909466L	0001	

NOTICE

Parts replacement does not solve this issue. Claims for replaced parts will be subject to review.



Technical Service Bulletin

NOTICE

Even with the new ZDC, there will not be a master switch at this time to turn the traffic sign-dependent speed warning off completely. The vehicle will however retain the last settings made by the customer after this update, including the deactivation of the audible warning. The implementation of a master switch is planned for a future software release.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9638		
Damage Code:	0039		
Diagnostic Time:	Software Update	0151 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2073371/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2073371**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



Technical Service Bulletin

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.