



Technical Service Bulletin

00 Invalid DTCs are stored, all functions still work normally

00 24 83 2064083/3 March 22, 2024. Supersedes Technical Service Bulletin Group 00 number 22-61 dated November 15, 2022 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 - 2024	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header (Added Model Year 24)
2	11/16/2022	Revised header (Added Model Year 23)
1	07/15/2021	Initial publication

Customer states:

- No customer concerns, it is found during PDI or any other diagnostic work.

Workshop findings:

- Various DTCs codes may be stored however no functional issue is present.

Technical Background

Due to various changes in production and ODIS software, various faults may be displayed or stored in the diagnostic tester even though there is no problem in the vehicle.

Production Solution

Ongoing changes in production and ODIS software development.

Service

No repair is available at this time.

1. Do not perform any repairs. Any repairs for this concern may be denied.

The DTC codes listed below with **no customer concern or functional issue can be ignored** as they have no impact on vehicle operation.



Technical Service Bulletin



NOTICE

DTCs listed below do not require a TAC ticket for repair authorization reporting.

Diagnostic address	Fault code	Status
03	B2F0100	sporadic
03	B2F0100	active
03	U112200	active
03	U112300	sporadic
03	U110500	sporadic
03	U112300	active
08	U110500	sporadic
08	B10AF04	sporadic
09	U110300	sporadic
13	U112300	sporadic
13	U110500	sporadic
19	P1D6C00	sporadic
19	U111F00	sporadic
19	U112300	sporadic
19	P1B0200	sporadic
19	C1313F0	sporadic
19	C11B8F0	sporadic
19	C12A5F0	active
19	U110500	sporadic
19	U164100	active
19	U12D000	active
19	U164500	sporadic



Technical Service Bulletin

19	U164500	sporadic
19	U164200	sporadic
44	U112100	sporadic
46	U110300	sporadic
5F	B126CF1	active
74	U112100	active
74	U112100	active
74	U112100	active
74	P169A00	sporadic
75	U110300	sporadic
75	U13EB00	active
8114	B16CE00	sporadic
82	U112100	active
82	U112100	sporadic
82	U122C00	sporadic
8C	U110100	active
8C	U110E00	active
8C	U112100	active
8C	P0C4800	active
A5	U112300	sporadic
A5	U112300	sporadic
A5	C1299F0	sporadic
A5	B187A00	active
C5	U110500	sporadic
C6	U15AC00	active
C6	U15BF00	active
C6	U15AE00	active



Technical Service Bulletin

C6	U15AB00	active
C6	U13AE00	sporadic
CB	U110500	sporadic
74	B200300	sporadic

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2064083**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.