


## Volvo Chassis - Omnitrac's Electronic Log Devices (ELD) GPS Signal Interference

Published 27 March 2024

### Valid For

Volvo VN models, Model year 2024

The Omnitrac's ELD may have trouble linking up with the GPS signal. Replacing the Safety Direct Processor (SDP), (FLC), Omnitrac's ELD unit, and overhead harness have had no positive effects. When both Bendix components mentioned are in the vehicle alongside the Omnitrac's ELD, the GPS signal will not connect. However, if the SDP is disconnected, the GPS signal connects without issues.

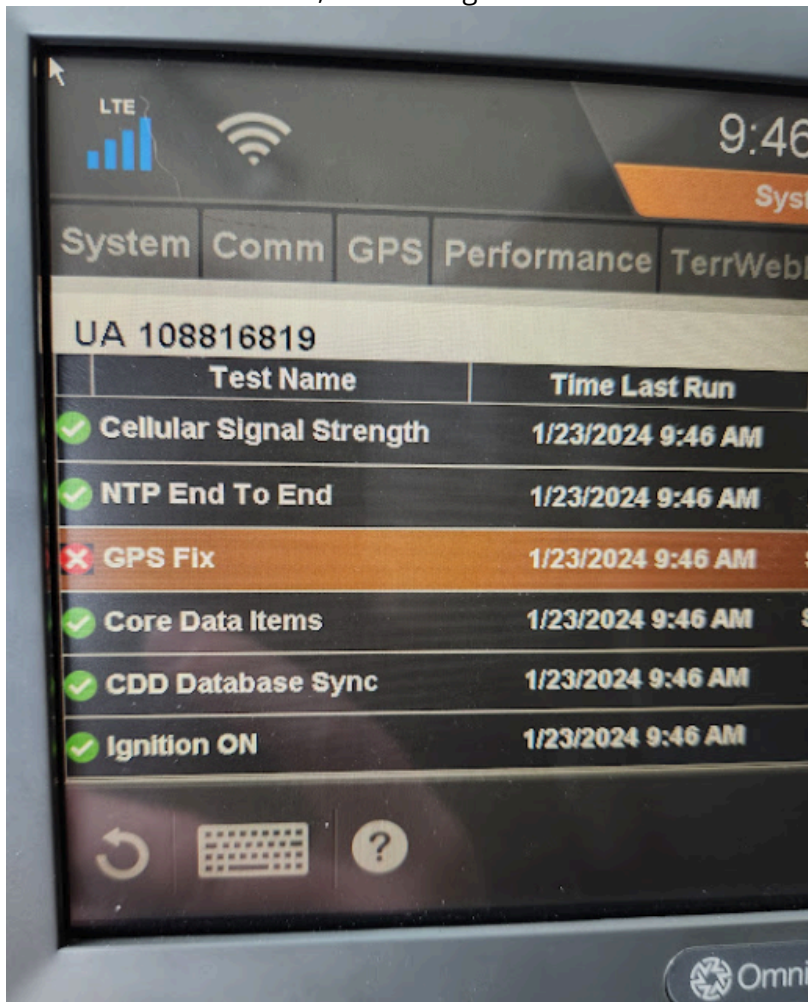

Replace the existing Safety Direct Processor (SDP) (part number 23960675) with the latest version (part number 24403980). Once the repair has been made verify the GPS signal is present.

## Related links and attachments

No links or attachments available



### Share

to others that might find it helpful

---



### Feedback

[Give feedback](#)

to help improve the content of this article