

Symptom-based workshop manual

36/17 ENU 8272

Service

8

Symptom in Vehicle Interior – Auxiliary Heater Does Not Function (M-No. 9M1 / 9M9): Retrofitting Heat Protection Mat (SY 36/17)

General information

Change overview:

Release	Date	Change
0	04/07/2017	First publication
1	03/07/2024	 New component status for heat protection mat available Work procedure adapted to new component status of heat protection mat

Model Line: Macan (95B)

- Model Year: As of 2014 up to 2023
- Equipment: Auxiliary heater (M-No. 9M1 / 9M9)
- Concerns: Circulating pump for auxiliary heater
- Symptom: The auxiliary heater cannot be started.
- Cause: The contacts in the circulating pump connector may be corroded as a result of water leaking into the connector housing.

The fault code **0582 Heater overheated** can be entered in the fault memory of the auxiliary heating control unit.

Remedial A heat protection mat will be secured around the circulating pump.

Action: $958121653 \Rightarrow$ Heat protection mat


Fasten heat protection mat on circulating pump



Hot components

- Risk of burns
- \Rightarrow Let hot components cool down.
- \Rightarrow Wear personal protective gear.

- 1 Remove exhaust pipe on auxiliary heater. ⇒ Workshop Manual '826019 Removing and installing exhaust pipe chapter on "Removing"'
- 2 Release electric plug connection \Rightarrow *Connector for circulating pump*-1- from the circulating pump \Rightarrow *Connector for circulating pump*-2- and disconnect it.

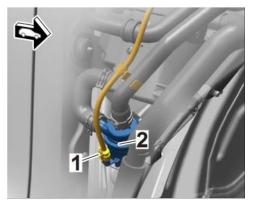


Connector for circulating pump

Information

Replace damaged or corroded components and connectors if necessary.

- 3 Clean connector contacts and component contacts using a suitable tool.
- 4 Connect electric plug connection \Rightarrow *Connector for circulating pump*-1- to the circulating pump \Rightarrow *Connector for circulating pump*-2- until it engages securely.

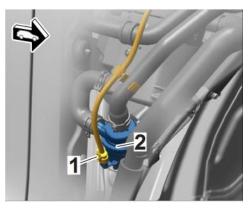


Connector for circulating pump

5 Install heat protection mat ⇒ *Position of heat protection mat*-1- on the circulating pump and lock press-studs ⇒ *Position of heat protection mat*-Arrows-. Arrow ⇒ *Position of heat protection mat*-2- must be pointing downwards.

AfterSales

Symptom-based workshop manual	Service	
	36/17 ENU	8272

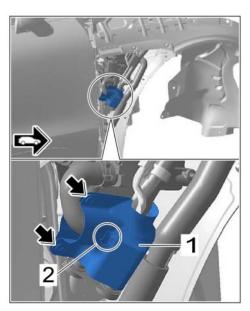

Position of heat protection mat

- 6 Install exhaust pipe on auxiliary heater. \Rightarrow Workshop Manual '826019 Removing and installing exhaust pipe - chapter on "Installing"'
- 7 Read out and delete the fault memory. ⇒ Workshop Manual '033500 Fault memory for on-board diagnosis'

Labor position and PCSS encryption

Labor position:

APOS	Labor operation	I No.
82724900	Reworking circulating pump	

PCSS encryption:

Location (FES5)	82720	Circulating pump
Damage type (SA4)	5011	Water leak

 \Rightarrow Workshop Manual '826019 Removing and installing exhaust pipe' References:

 \Rightarrow Workshop Manual '033500 Fault memory for on-board diagnosis'

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know how to do the job properly and safely. Part numbers listed in these builtetins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2024 Porsche Cars North America, Inc.

