



Service Bulletin

Bulletin No.: 21-NA-245

Date: April, 2024

TECHNICAL

Subject: Shift to Park Message Displayed in Driver Information Center (DIC)


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission: (Automatic)
		from	to	from	to		
Buick	Regal	2011	2020	—	—	All	M3D, M3T, MRC, MHH, MHK, MH8, M7U, M7W, MDK, MH7
Chevrolet	Camaro	2016		M5T, M5U, MF6, MI1, MI2, MI4, MGL			

Involved Region or Country	North America, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Europe, Russia, Middle East, Israel, Japan, GM Korea Company, China, Taiwan, Philippines
Condition	Some customers may comment on seeing that a Shift to Park message has appeared on the DIC screen.
Cause	The cause of the condition may be that the Park Switch is unable to pull the signal circuit low, telling the BCM it is electronically in Park.
Correction	Replace the transmission control assembly and install a jumper harness following the steps in the Service Procedure below.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

If you encounter a vehicle with the above concern, complete the following procedure:

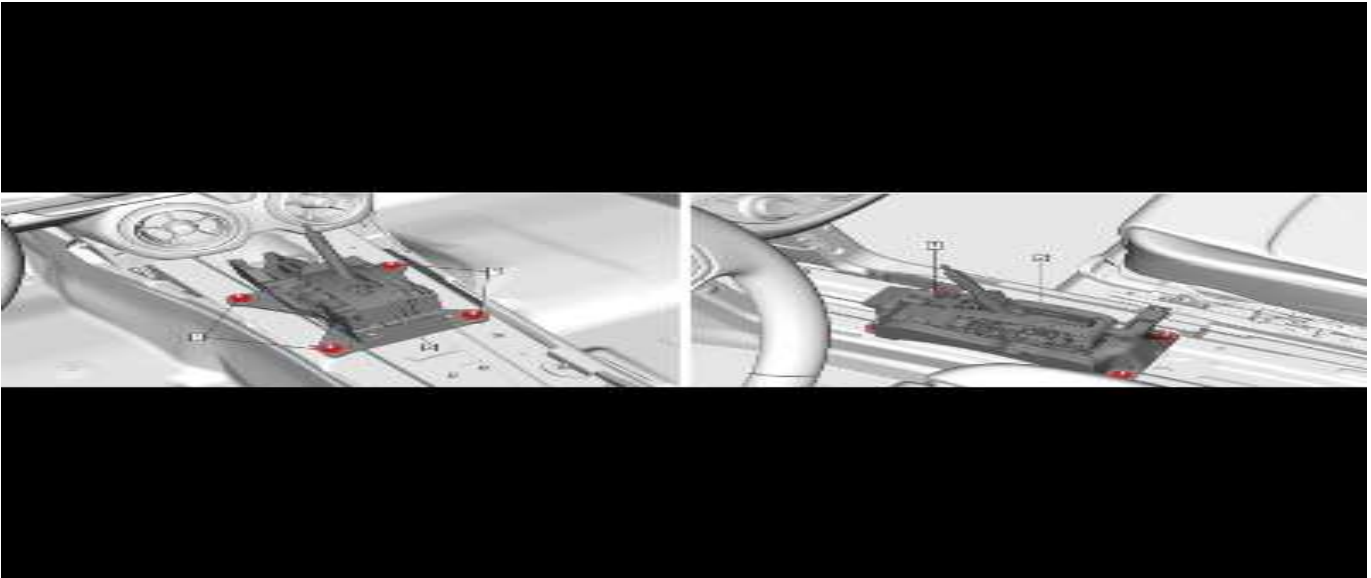

6595991

Note: Camaro shifter shown on the Left. Regal shifter shown on the right.

1. Remove the transmission control assembly from the vehicle (2). Refer to *Transmission Control Replacement* in SI.



5404694

Note: Ensure the jumper harness is not twisted or kinked.

2. Install the jumper harness between the shift control and the console body harness connector.



6595991

3. Install the new transmission control assembly (2). Refer to *Transmission Control Replacement* in SI.
4. Start the vehicle and verify that the Shift to Park message is NOT displayed.

Parts Information

Causal Part	Description	Vehicle	Engine	Part Number	Qty
X	CONTROL ASM-A/TRNS	Camaro	All	84588250	1
X	CONTROL ASM-A/TRNS	Regal (2018-2020)	MRC	39224646	1
X	CONTROL ASM-A/TRNS	Regal (2018-2020)	M3D, M3T	39224645	1
X	CONTROL ASM-A/TRNS	Regal (2011-2013)	MDK	22966996	1
X	CONTROL ASM-A/TRNS	Regal (2014-2017)	M7U, M7W	22966995	1
X	CONTROL ASM-A/TRNS	Regal (2012-2017)	MHH, MHK, MH8	22966995	1
X	CONTROL ASM-A/TRNS	Regal (2011)	MH7	22966995	1
N/A	HARNESS ASM-A/TRNS CONT WRG (Jumper)	All	All	85102841	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Header	Labor Time
8486068*	Transmission Control Assembly Replacement, Add Jumper Harness	Camaro	0.9 hr
		2011-2017 Regal	
Add		2018-2020 Regal	0.1 hr
*This is a unique Labor Operation is for bulletin use only.			

Version	2
Modified	Released December 17, 2021 Revised March 28, 2024 – Added Buick Regal information and Important statement.

