



TECHNICAL SERVICE BULLETIN

Classification: FE23-001B	Reference: NTB23-055B	Date: March 12, 2024
------------------------------	--------------------------	-------------------------

FUEL ODOR

This bulletin has been amended. See **AMENDMENT HISTORY** on the last page.
Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2021-2023 Rogue (T33)
APPLIED DATES: Built on or before July 28, 2023
APPLIED ENGINES: KR15DDT

IF YOU CONFIRM

The customer states they smell fuel,

AND

The MIL is not ON and there are no stored DTCs.

ACTION

1. Check for evidence of any fuel leak.
2. Check for any malfunctioning fuel system or EVAP system parts.
3. If no concerns are found, replace the PCV hose with the one listed in **PARTS INFORMATION** following the **SERVICE PROCEDURE** in this bulletin.

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Check for evidence of any fuel leak and correct as necessary.
2. Check for any malfunctioning fuel system or EVAP system parts and correct as necessary.
3. If no concerns are found, replace the PCV hose with the one listed in **PARTS INFORMATION** as follows:

- a. Remove the engine cover by pulling it off in an upwards direction.



Figure 1

- b. Locate the PCV hose to be replaced.

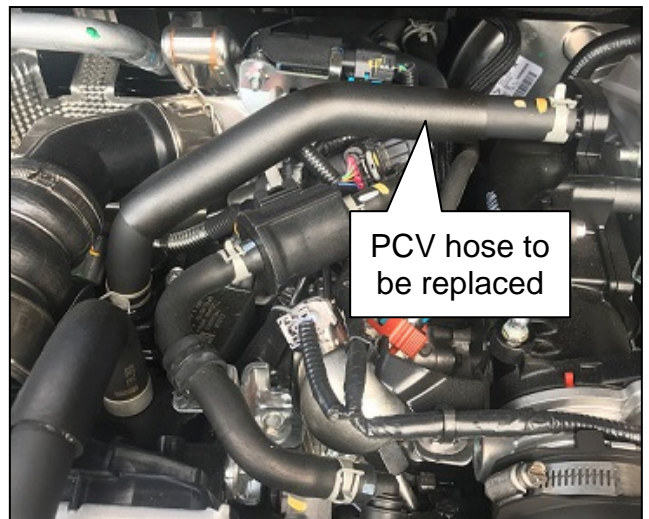


Figure 2

- c. Relocate the clamps that secure the PCV hose, to allow for PCV hose removal.

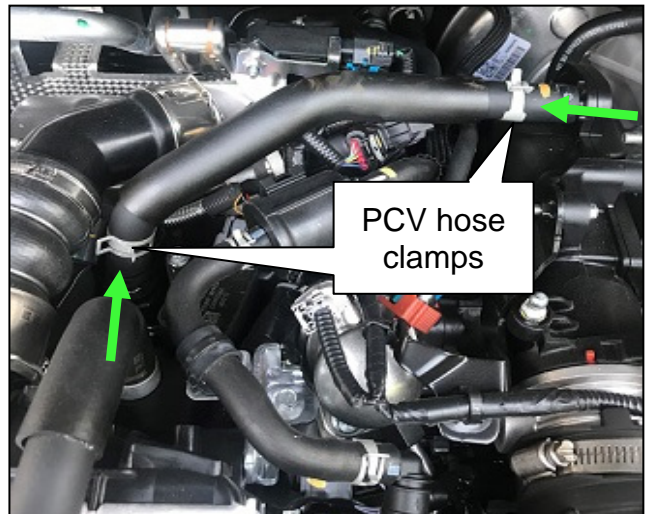


Figure 3

- d. Pull on the PCV hose in the directions shown in Figure 4, for PCV hose removal.

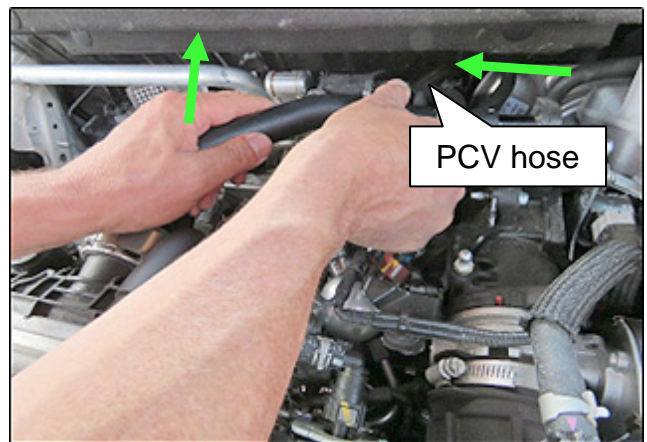


Figure 4

- e. Install the new PCV hose in the reverse order of removal.
- f. Reinstall the engine cover.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
ADM/V BLOWBY-HOSE (HOSE ASSY-BLOWBY)	11823-6RC4A	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace PCV Hose	(1)	AR32AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the Blowby Gas Hose (11823-*****) as the Primary Failed Part (**PFP**).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (**FRT**).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
June 21, 2023	NTB23-055	Original bulletin published
November 27, 2023	NTB23-055A	Amended to add APPLIED DATES
March 12, 2024	NTB23-055B	PARTS INFORMATION updated