



Service Bulletin

Bulletin No.: 24-NA-001

Date: April, 2024

TECHNICAL

Subject: Headlamps, Daytime Running Lamps, and/or Taillamps Flash Off/On

This Service Bulletin replaces PIC6530. Please discard PIC6530.

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Trax	2024	2024	SOP	November 22, 2023	—	—

Involved Region or Country	North America, Guatemala, Honduras, Israel, Palestine
Additional Options (RPOs)	Equipped with RPO IOR
Condition	Some customers may comment that while parked or driving in bright daylight, under certain conditions the exterior lights (DRLs, headlamps and/or tail lamps) may flicker/flash between DRL/low beam modes. They may also report that the green low beam indicator on the Instrument Panel Cluster (IPC) flashes on/off, and/or that the cluster lighting level cycles from bright to dim in sync with the exterior lighting condition.
Cause	The cause of the condition may be the ambient light sensor.
Correction	Replace the ambient light sensor. Refer to <i>Ambient Light and Security Indicator Sensor Replacement</i> in SI.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Parts Information

Causal Part	Description	Part Number	Qty
X	Ambient Sun Load Temp & AMB LGT & Security Sensor	13549088	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1086788*	Ambient Light Sensor Replacement	0.2 hr
*This is a unique Labor Operation for bulletin use only.		

Version	3
Modified	Released January 26, 2024 Revised February 05, 2024 – Added involved regions/countries and changed Labor Time under Warranty Information. Revised April 03, 2024 – Updated the Condition, Correction and Parts Information sections.

