



Bulletin No.: PIT6136  
Published date: 03/20/2024

## Preliminary Information


### PIT6136 Diagnostic Tip: Antilock Brake System (ABS) Lamp Illuminated, Diagnostic Trouble Code (DTC) C0513, C0514, C0515, C0516

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado EV	2024	All	All	All	All

Involved Region or Country	North America
Condition	A customer/driver may comment of a ABS light illuminated followed with a "Service Stability " message.
Cause	This may be due to the ABS wiring harness making contact with the top edge of the rear drive unit (DU) above the right rear axle.  See Photos Below.



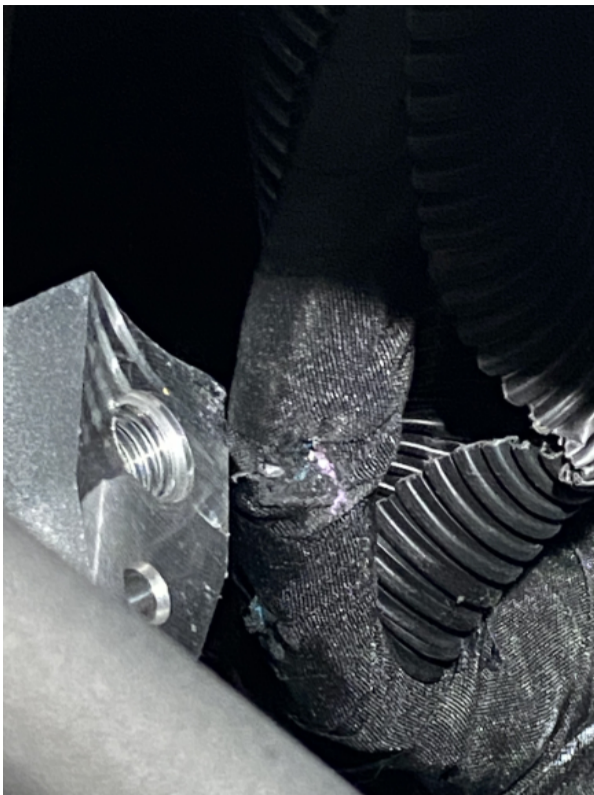

**Correction:**

Inspect the location show above the right rear axle and repair wiring and re-route harness as needed.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5430902	Wire to wire repair	Use published time

Version History

Version	1
Modified	03/20/2024 - Created on.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.