

Technical Service Bulletin

Authored Date.	11/04/2024	11/04/2024		
Doc No.	IATSB002099	IATSB002099		
Title	Instrument Panel Drain H	Instrument Panel Drain Hose – Water Ingress		
Affected Vehicle(s)	Grenadier	PF000001 -		
This Technical Service Bulletin (TSB) should only apply to vehicles that demonstrate the described issue below.				

Reason for this document

Issue: An issue has been identified on a small percentage of the affected vehicles where water will appear in the footwell and down the tunnel.

Cause: Manufacturing Issue.

Action: Follow the procedure below.

Workshop Procedure

Instrument Panel Drain Hose - Water Ingress - Procedure.

Operation	SRO	Repair Time
Sealant Install	XTSBIPDH001	6.5 Hours

Supplies

Part Number	Description	Qty
BetaFill 216	Sealant	1





Procedure

1	Raise and support the vehicle on a suitable 2-post lift. Refer to: TOPIC_0000000382 - Lift Vehicle On Ramp		
2	Remove the HVAC unit. Refer to: TOPIC_0000005008 - HVAC Unit - Petrol (Remove for Access and Install) TOPIC_0000005010 - HVAC Unit - Diesel (Remove for Access and Install)		
3	Note: Image is showing the clip not installed correctly. The hose must be secured to the floor Note: Make sure the gap between the floor and the hose is covered in the recommended sealant. **Page 15.** **Page 25.** **Page 26.** **Page		
4	Install the HVAC Unit Refer to: TOPIC_0000005008 - HVAC Unit - Petrol (Remove for Access and Install) TOPIC_0000005010 - HVAC Unit - Diesel (Remove for Access and Install)		
5	Release the vehicle.		

Change History

Reference No.	Date	Description
IATSB002099	11/04/2024	First release

