

Reference

27492

Model Categories

Road , Off-Road

Priority

No

Subject

Service/Technical

Delivered

30/05/2024

Posted To

General Manager / Business Owner , Technician , Parts / Accessories Coordinator , Sales Executive , Clothing Sales , Sales Manager , Aftersales Manager , Service Leader / Advisor , Accounts / Admin , Marketing Executive

TECHNICAL UPDATE – ROCKET 3 STORM TRIUMPH SHIFT ASSIST ACCESSORY FITMENT



Central Warranty has issued a Technical Update on all VINS for both the new Rocket 3 Storm R and Rocket 3 Storm GT.

Accessory Triumph Shift Assist (TSA) will not operate when installed and configured with OEM foot controls. Triumph has carried out an investigation of this TSA concern and identified the root cause. We are currently evaluating the next steps for resolution and will update accordingly.

When fitting the accessory TSA, dealers must apply the opposite shift configuration via TDT – for example, select 'Rear' configuration if 'Forward' foot controls are fitted.

Adjust Shift Force Sensor Shift Pattern

Select a foot control configuration

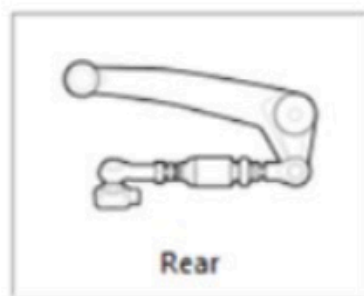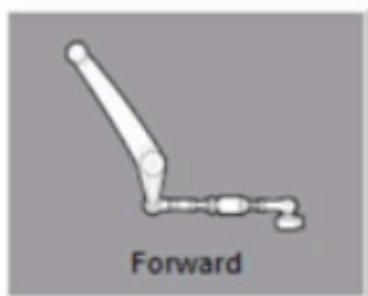

The shift configuration can be adjusted using the Triumph Diagnostic Tool. Navigate to Diagnostics -> Engine ECM -> Adjust and select Adjust Shift Force Sensor Shift Pattern. There is no requirement to replace any parts under warranty at this time.

If you have any additional questions, please contact Triumph Customer Support at (888) 284-6288.