



TECHNICAL SERVICE BULLETIN

6.7L - Illuminated MIL With DTCs P2201, P2209, P220E And/Or P24FE Stored In The PCM - Built On Or Before 31-Oct-2022

24-2136

09 May 2024

Model:

Ford	Engine: 6.7L
2020-2022 F-Super Duty	Built on or before 31-Oct-2022

Markets: North American markets only

Issue: Some 2020-2022 F-Super Duty vehicles built on or before 31-Oct-2022 and equipped with a 6.7L engine may exhibit an illuminated MIL with DTC P2201, P2209, P220E and/or P24FE stored in the PCM. This may be due to the software in the PCM and the NOX sensor 11. To correct the condition, follow the Service Procedure to replace the NOX sensor 11 and reprogram the PCM and TCM.

Action: Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2020-2022 F-Super Duty
- Built on or before 31-Oct-2022
- 6.7L diesel engine
- Illuminated MIL with DTC P2201, P2209, P220E and/or P24FE stored in the PCM

Parts

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
LC3Z-5L248-A	1	1	1	NOx Sensor 11

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Special Service Part (SSP)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SSP/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2020-2022 F-Super Duty 6.7L: Retrieve DTCs Replace The NOx Sensor And Reprogram The PCM And TCM (Do Not Use With Any Other Labor Operations)	242136A	1.1 Hrs.

Repair/Claim Coding

Causal Part:	RECALEM
Condition Code:	04

Service Procedure

1. Replace the NOX sensor 11. Refer to WSM, Section 303-14.
2. Reprogram the PCM and TCM using the latest software level of the FDRS scan tool.
3. Download and run the "PCM - Diesel Particulate Filter (DPF) Regeneration" application via navigating to Toolbox menu in FDRS and follow the on-screen prompts.

NOTE: Advise the customer that this vehicle is equipped with an adaptive transmission shift strategy which allows the vehicle's computer to learn the transmission's unique parameters and improve shift quality. When

the adaptive strategy is reset, the computer will begin a relearning process. This relearning process may result in firmer than normal upshifts and downshifts for several days.

© 2024 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.