

04-024: T680 Next Gen Fairing Pin Replacement

5/15/2024



[Edit](#)



[Clone](#)

04-024

T680 Next Gen Fairing Pin Replacement

Subject

T680 Next Gen Fairing Pin Replacement

Whats New Abstract

Certain T680 Next Gen fairings may have a loose or missing bushing that allows the rear partial fairing to rattle during operation. Parts and procedures are available to replace the pin on the fairing (both sides) with a bolt/spacer combination to reduce fairing rattle.

Condition

Fairings on certain T680 Next Gen chassis may loosen and rattle during operation due to loose or missing fairing bushings. Pins on the fairing will be replaced with a spacer and bolt/nut assembly to reduce fairing rattle.

Chassis Affected

Certain T680 Next Gen chassis built from 01/18/2021 through current production with rear partial fairings.

Action

Fix-As-Fail

If a customer comes into your dealership and has a loose or missing lower rear fairing bushing, follow the procedures to replace the lower rear fairing pin(s) with a bolt/nut/spacer assembly. (One per side)

Warranty

For repairs completed by 06/01/2025, Kenworth will pay for parts at dealer net plus applicable mark-up and labor:

- **0.3 hours** to replace fairing pin with spacer and bolt/nut assembly (one side only). Use Quick Claim

code **04024A.**

- **0.3 hours** to replace fairing pins with spacer and bolt/nut assembly (both sides). Use Quick Claim code **04024B.**
- File an additional claim for extraordinary circumstances. A quick claim for standard labor must be filed first.
- File the claim within 14 days in accordance with Warranty Policy [CA009](#).

Take off parts disposition: N/A

PRWS CLAIM CODING			
Campaign Code:	04024	Campaign Type	Field Repair
Claim Category:	Truck	Repair Type	Fix-As-Fail
Customer Concern Code	066	Causal Code	19
Corrective Action Code	22	Responsibility Code:	Camp
Failure Location	004-005-003	Causal Part	N11-1823/R
Supplier Code	N/A	SRT Code	04-xxx 0.3 hrs Replace fairing pin with spacer and bolt/nut assembly per Bulletin Procedures (One side) 04-xxx 0.3 hrs Replace fairing pin

			with spacer and bolt/nut assembly per Bulletin Procedures (Both sides)
--	--	--	---

Parts

Parts are available from PACCAR Parts.

Quantity	Part Number	Description
1 per side	N80-1059	Spacer
1 per side	R34-6002-08070RH0M	Bolt, M8
1 per side	W20-6011-08TDY0Z	Nut
2 per side	HWC12241	Washer

Procedure

Please follow your dealership's safety procedures and precautions to ensure the vehicle can be safely repaired and maintained.

Read all steps before beginning.

Follow the steps in the attached [Procedures Document](#)

Attachments

[Procedures Document](#)

Authored by: JB3