

**Reference**

27607

**Model Categories**

Road , Off-Road

**Priority**

No

**Subject**

Parts, Clothing &amp; Accessories

**Delivered**

30/05/2024

**Posted To**

General Manager / Business Owner , Technician , Parts / Accessories Coordinator , Sales Executive , Clothing Sales , Sales Manager , Aftersales Manager , Service Leader / Advisor , Accounts / Admin , Marketing Executive

---

## UPDATE - SPEED 400 & SCRAMBLER 400 X IMMOBILISER LIGHT

As investigation into the Speed 400 & Scrambler 400 immobiliser light continues, Triumph has decided to revert to the previous version of immobiliser software. This will be released in the next TDT version 2024-07, which is due for release next Tuesday, May 21st, 2024.

**Any bikes that are affected by U0167 must have the immobiliser software updated using TDT 2024-07 following its release next week.**

In the meantime, we recommend that you **do not** carry out any further immobiliser updates on bikes in service using TDT 2024-06. If you need to carry out any PDIs on these models for handover prior to the release of TDT 2024-07, continue as normal. If bikes are due for delivery after the release of TDT 2024-07, we recommend that you update the immobiliser after then and before handover to the customer using TDT 2024-07.

Note that this software reversion (to TDT 2024-07) may lead to a repeat of the earlier issue that caused incorrect triggering of DTC U1180 and the immobiliser warning light on the instruments remaining lit after engine start. While this is not an acceptable condition, it does have less impact to the customer than U0167 which may prevent the engine from starting.

We continue to work with our partners to investigate the root cause of this issue and will release further updated software in due course.

If you have any additional questions, please contact Triumph Customer Support at (888) 284-6288.

