



## STAR ONLINE PUBLICATION



**Case Number:** S2408000050

**Release Date:** May 2024

**Symptom/Vehicle Issue:** After A Recent Service Repair The Vehicle is Setting Diagnostic Trouble Codes (DTCs) B0090-49 Left Frontal Acceleration Sensor-Internal Electronic Failure, B0095-49 Right Frontal Acceleration Sensor-Internal Electronic Failure

**Technician Observation:** The technician observed the above sensor DTCs setting after replacing both sensors.

**Repair Procedure:** Verify the sensors used match the part number of the ones removed, currently if a newer sensor part number is used (68606357AA) it can be used with the newer Occupant Restraint Controller (ORC), however, the original ORC will require the original sensors (68284052AA) the vehicle was built with.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.**