

**Technical Service Bulletin (TSB)**  
**Oil Leak from Turbo Oil Supply Line**

<b>REFERENCE:</b>	<b>TSB:</b> 09-011-24 <b>GROUP:</b> 09 - Engine	<b>Date:</b>	May 14, 2024	<b>REVISION:</b>	09-018-23
<b>VEHICLES AFFECTED:</b>	<b>2023 (WS) Grand Wagoneer/Wagoneer</b> This bulletin applies to vehicles built on or after March 10, 2022 (MDH 0310XX) and on or before April 12, 2023 (MDH 0412XX) equipped with a 3.0L I6 Hurricane HO Twin Turbo ESS (Sales Code EFC).			<b>MARKET APPLICABILITY:</b>	
				<input type="checkbox"/> **NA**	<input checked="" type="checkbox"/> MEA
				<input type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
<b>CUSTOMER SYMPTOM:</b>	Customers may experience the following: <ul style="list-style-type: none"> <li>Oil leak from turbo oil supply line.</li> </ul>				
<b>CAUSE:</b>	Internally damaged oil feed line hose.				

This bulletin supersedes Technical Service Bulletin (TSB) 09-018-23, date of issue September 12, 2023, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include removing a market, and an NA RSU cancellation note.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 23-263, date of issue September 12, 2023. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

**NOTE: \*\*This proactive service action no longer applies for North America. Please follow published service procedures in Service Library to diagnose and repair the vehicle.\*\***

**REPAIR SUMMARY:**

This bulletin involves replacing the turbo oil feed line.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-55-35-95	Line, Turbo Oil Feed - Replace (2 - Skilled)	1 - Engine Repair and Performance	3.5 Hrs.
Failure Code	ZZ	Service Action	

## RELATED LOPS:

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-55-35-62	4x4 Equipped (2 - Skilled)	1 - Engine Repair and Performance	0.2 Hrs.
09-55-35-63	EGR Equipped (2 - Skilled)	1 - Engine Repair and Performance	0.5 Hrs.

## SPARE PARTS:

Qty	Part No.	Description	Notes
1	68442825AF	Tube, Oil Feed	Includes O-Rings
2	68381406AC	Gasket, Turbocharger To Catalytic Conv.	
2	06102622AA	Screw, Pan Head Torx	M6 - Oil Feet To Block
2	06513534AA	Screw, Pan Head	M6 X 1.0 X 12.00 - Oil Feet To Turbocharger
2	68646936AA	Clamp, Exhaust	Turbo To Catalytic Converter
2	68521428AB	Clamp, Exhaust	Catalytic Converter To Exhaust Pipe
4	06506497AA	Bolt, Hex Head	M12
(AR)	68171066PB	Oil	0W-40 - Quart

## DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

## REPAIR PROCEDURE:

1. Replace the turbocharger oil supply line. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info>09 - Engine, 3.0L GMET6 / Turbocharger System / Lines, Tubes And Hoses, Turbocharger, Oil and Coolant / Removal and Installation.
2. Check engine oil level and add as needed.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*