




Figure 1. External Power Adapter

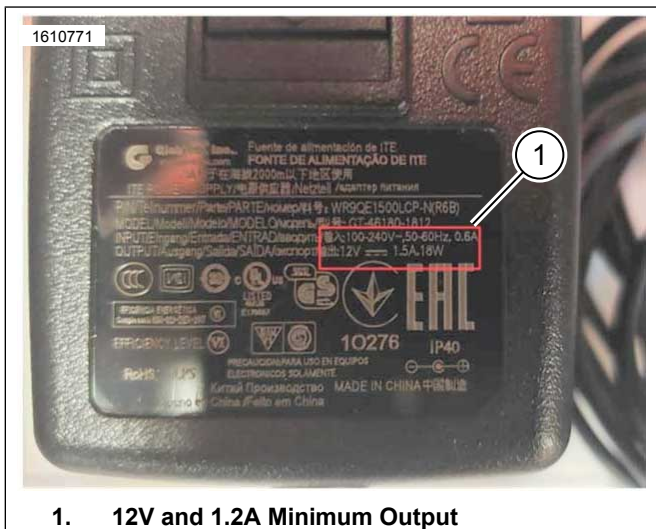

1. 12V and 1.2A Minimum Output

Figure 2. 12V and 1.2A Output

Special Tool: TECHLINK 3 (PART NUMBER: HD-48650-TL3)

Table 4. Software Version

BCM Software	Version
Current	16.3.5.2
Update	16.3.8.2

Verify that the most up-to-date software is installed. Check software version using DT II. Refer to Table 4.

Special Tool: DIGITAL TECHNICIAN II (PART NUMBER: HD-48650)

Body Control Module (BCM) Reflash Sequence

1. Connect battery tender to vehicle.
 - a. Verify battery is fully charged before proceeding.
 - b. 2023 Models, connect tender using clamps at the starter positive terminal and chassis ground.
 - c. 2024 models, connect tender using supplied tender connection on the vehicle.

2. Connect TL-3 to vehicle.
3. Connect external power to TL-3 using appropriate power supply providing at least:
 - a. 12 V
 - b. 1.2 A
4. Place vehicle in Accessory mode.
 - a. Press and hold trip button 5 seconds.
5. Open DT II program and establish communication with vehicle.
6. Proceed to reflash BCM and follow on-screen directions.

Credit Procedure

NOTE

Enter bulletin number M1644 in Event Comments.

Submit a warranty claim per Table 5.

Table 5.

ITEM	DATA
Claim Type	PRD/MC/DEM - PDI/Standard claim
Problem Part Number	Refer to Table 2.
Quantity	Leave Blank
Primary Labor Code	1736
Time	0.2 hours
Customer Concern Code	9203
Condition Code	1736