



2024-05-01

[illegible]

Table 4. ECM Software Version

ECM Current Version	ECM Updated Version
41001514e	41001514F
41001516E	41001516F
41001518D	41001518E
41001519D	41001519E
41001520D	41001520E

ECM Reflash Sequence

1. Connect vehicle to battery tender.
 - a. Verify battery is fully charged before proceeding.
2. Connect external power to TL-3 appropriate power supply providing at least:
 - a. 12Voltage (V)
 - b. 1.2Amperes (A)
3. Place vehicle's ignition to ON.
4. Open DT II program and establish communication with vehicle.
5. Proceed to reflash the ECM and follow on-screen directions.

NOTE

As directed in DT II reflash procedure, after the reflash is completed and Ignition cycle is requested. TL-3 and battery tender should be disconnected from the vehicle to allow modules to completely shut off during the Ignition cycle.

Dealer Inventory Instructions

1. Update all vehicles in dealership inventory.
 - a. Refer to Vehicles Affected.
 - b. Refer to Required Dealer Action.
2. To claim credit for work performed, Refer to Credit Procedure.

Credit Procedure**NOTE**

Enter bulletin number M1645 in Events Comment.

Submit a warranty claim per Table 5.

Table 5. ECM Updates

ITEM	DATA
Claim Type	PRD/MC/DEM - PDI/Standard claim
Problem Part Number	41001351
Quantity	Leave Blank
Primary Labor Code	7849
Time	0.2 hours
Customer Concern Code	9203
Condition Code	7849