



GROUP	MODEL
Customer Satisfaction	2011-2016MY Sportage (SL) 2017-2022 Sportage (QL)
NUMBER	DATE
CS2302 (Rev 5, 6/05/2024)	January 2023

## TECHNICAL SERVICE BULLETIN

### CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC

SUBJECT:

### UPGRADE & DECAL INSTALLATION (CS2302)

#### NOTICE

**This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.**

This bulletin provides the procedure to upgrade the software logic of the Integrated Body Control Unit (IBU) or Body Control Module (BCM) system on some 2011-2016MY Sportage (SL) vehicles produced from May 6, 2010 through Nov 16, 2015, and 2017-2022MY Sportage (QL) vehicles produced from Dec 10, 2015 through Dec 7, 2021, which may not be equipped with an immobilizer. This logic upgrade will add anti-theft ignition start logic to the vehicle's system operation **which activates when the vehicle is locked with the use of the key fob.** Follow the procedure outlined in this publication to apply the improved logic to the 'IBU-BCM' system using the KDS ECU Upgrade function as described in this bulletin. For confirmation that the latest reflash has been applied to a vehicle you are working on, verify the ROM ID using the table on page 3 of this bulletin.

Window decals should also be applied to both front windows in accordance with the instructions on page 8 to indicate this anti-theft S/W logic upgrade has been completed (unless a customer specifically requests, they not be installed). An initial supply of window decals will be shipped directly to dealers. Should there be a delay in receipt of this supply, please track any customers that may need window decals installation upon receipt of the stickers.



#### NOTICE

**To assure complete customer satisfaction, always remember to refer to KDealer+ Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.**

SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

### 📌 IMPORTANT

Since the launch of this software upgrade, Kia initially identified a compatibility issue involving vehicles equipped with a Kia Genuine Remote Start Accessory which results in the activation of the burglar alarm when the remote start is used. Kia has rectified the Kia Genuine Remote Start Accessory compatibility issue. Refer to [CS2310 Remote Start Control Module Upgrade for Anti-Theft Logic Compatibility](#).

After the 'updated' software installation is completed, the use of the key fob to lock and unlock the vehicle will be **required** to activate/deactivate the Anti-Theft system

### ECU Upgrade Procedure:

To correct this condition, the ECU should be reprogrammed using the KDS download, as described in this bulletin.

Upgrade Event Name
653. SL BCM UPGRADE FOR NON-IMMO VEHICLE
652. QL BCM UPGRADE FOR NON-IMMO VEHICLE

### 📄 NOTICE

- Confirm a fully charged battery (12.3 volts or higher is necessary) is used or utilize a fully charged jump starter box connected to the battery.
- **Ensure the KDS GDS is sufficiently charged at 60% or higher prior to reflash.**
- All ECU upgrades must be performed with the ignition set to the 'ON' position unless otherwise stated.
- **Damaged VCI II units should not be used and promptly replaced.**
- Be careful not to disconnect the VCI-II connected to the vehicle during the ECU upgrade procedure.
- **DO NOT start the engine during ECU upgrade.**
- DO NOT turn the ignition key 'OFF' or interrupt the power supply during ECU upgrade.
- **When the ECU upgrade is completed, turn the ignition 'OFF' and wait 10 seconds before starting the engine.**
- ONLY use approved ECU upgrade software designated for the correct application.


### 📌 IMPORTANT

It is recommended to ALWAYS check the Electronic Parts Catalog (EPC) to locate the ECU Part Number respective to Auto/Manual Mode ROM IDs. DO NOT reference the parts label affixed to the ECU.

SUBJECT:


## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

### NOTICE

Before attempting an ECU upgrade on any Kia model, make sure to first determine whether the applicable model is equipped with an immobilizer  security system. Failure to follow proper procedures may cause the PCM to become inoperative after the upgrade and any claims associated with this repair may be subject to chargeback.

### ROM ID INFORMATION TABLE:

Upgrade Event #653 (SL)

Model	Model Year	System	IMMO 	ECU P/No.	ROM ID	
					Previous	New
Sportage (SL)	11-16MY	BCM	No	95400 3WLCO	1.0 - 1.99	4.10
				95400 3WLDO	4.00	
				95400 3WMCO	4.01	
				95400 3WMDO	4.02	
				95400 3WMDO	4.03	
				95400 3W820	1.0 - 1.14	1.20
				95400 3W830		
				95400 3W920		
				95400 3W930		
				95400 3W821	4.00	4.10
				95400 3W832	4.01	
				95400 3W921	4.02	
				95400 3W932	4.03	
				95400 3W822	1.00	1.10
				95400 3W833	1.01	
				95400 3W922	1.02	
95400 3W933	1.03					


*Continued on page 4...*



SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

## Upgrade Event #652 (QL)

Model	Model Year	System	IMMO 	ECU P/No.	ROM ID		
					Previous	New	
Sportage (QL)	17-22MY	BCM	No	95400 D9700	1.00	1.00	
				95400 D9710	1.01		
				95400 D9760	1.02		
				95400 D9770	1.03		
				95400 D9770	1.04		
				95400 D9770	1.07		
				95400 D9EWO	1.10		
				95400 D9EWO	1.11		
				95400 D9EYO	1.12		
				95400 D9EYO	1.12		
				95400 D9701	2.02		1.00
				95400 D9711			
				95400 D9761			
				95400 D9771			
				95400 D9771			
				95400 D9771			
				95400 D9EW1	1.00	1.00	
				95400 D9EY1			
				954A0 D9AX0			
				954A0 D9AY0			
954A0 D9AZ0							
954A0 D9AZ0							
954A0 D9BDO	1.04	1.00					
954A0 D9BEO							
954A0 D9BEO							
954A0 D9BFO							
954B0 D9AX0	2.00	1.00					
954B0 D9AY0							
954B0 D9AZ0							
954B0 D9AZ0							
954B0 D9BDO							
954B0 D9BDO							
954B0 D9BEO	2.03	1.00					
954B0 D9BEO							
954B0 D9BFO							

*To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's ECM ROM ID and reference the Information Table as necessary.*

SUBJECT:

# CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

## NOTICE

**Prior to performing the ECU upgrade, be sure to check that the KDS is fully charged.**

1. Connect the VCI-II to the OBD-II connector, located under the driver's side of the instrument panel.

## NOTICE


The ECU upgrade function on KDS operates wirelessly. It is not necessary to perform the upgrade via USB cable.




2. With the ignition ON, turn ON the KDS tablet. Select 'KDS' from the home screen.



3. Confirm communication with VCI (A) and then configure the vehicle (B) using the 'AUTO VIN' (C) feature.

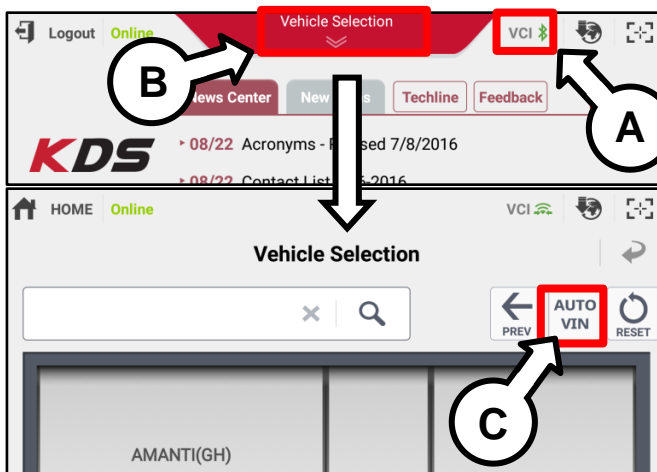

4. Select 'ECU Upgrade'.

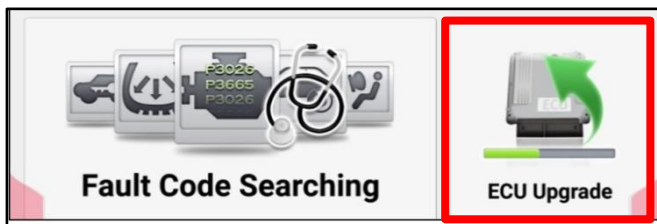


SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

- The KDS will check the server for recently uploaded Events and then automatically download Upgrade Event #652 (QL) or #653 (SL).

### NOTICE


The vehicle must be identified in Vehicle Selection to download an Event for that vehicle.

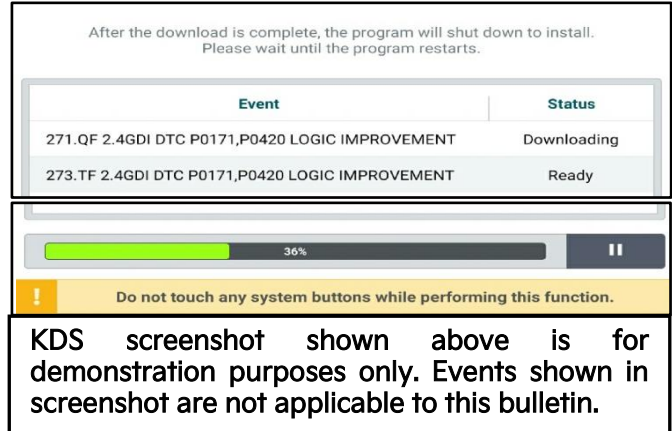

- Select Auto Mode.

### CAUTION


Do NOT attempt to perform a Manual Mode upgrade UNLESS Auto Mode fails. Always follow the instructions given on the KDS in either Auto or Manual mode.

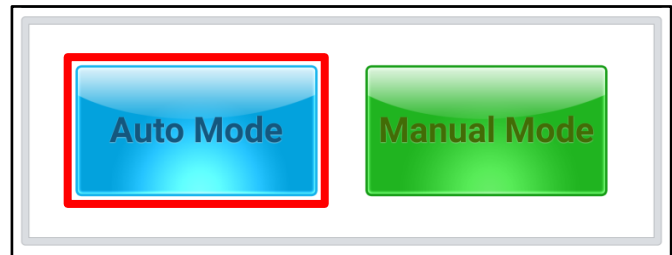

- Select the IBU/BCM system under the System selection menu.

Touch ID Check (D) and confirm that the latest update is available.


Select Upgrade Event #652 (QL) or #653 (SL) and select Upgrade to continue.

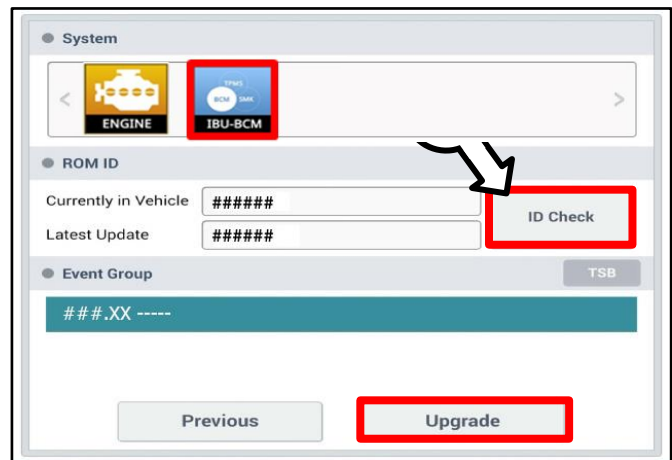

- The ECU upgrade will begin and the progress of the upgrade will appear on the bar graph. Upgrade part (1/2) (E) will download the upgrade event to the VCI-II. Upgrade part (2/2) (F) will upgrade the ECU.

### CAUTION

Do not touch the system buttons (like 'Back', 'Home', 'etc.') while performing ECU Upgrade.

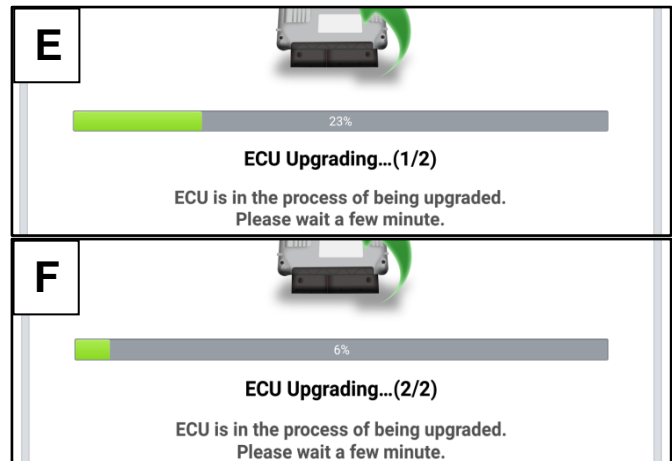


SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)


9. If a "Communication Fail" screen appears, verify that the VCI-II and KDS are communicating properly. Select 'OK' and restart the from step 4.

### NOTICE

**If an error notice continues to appear or if the upgrade cannot be performed, DO NOT disconnect the KDS/VCI-II. Contact GIT America Help Desk at (888) 542-4371 or Techline.**

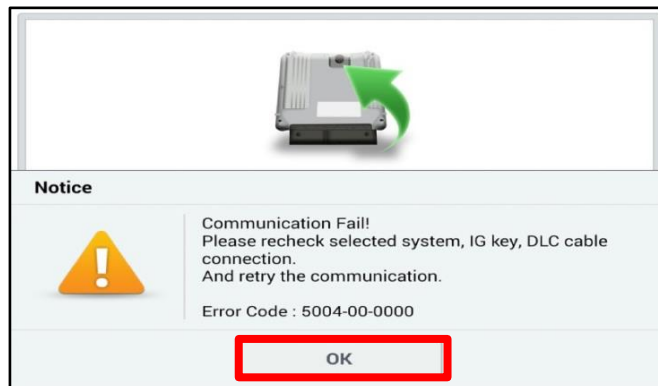


10. When instructed on the KDS, turn the ignition OFF for ten (10) seconds then back on. Select 'OK' to continue.

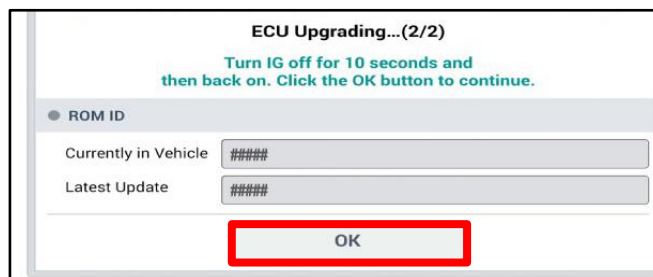

11. Once the upgrade is 100% complete, select 'OK' to finalize the procedure.


### IMPORTANT

**After ECU upgrade reaches 100%, the last data validation will take up at least 10 minutes.**

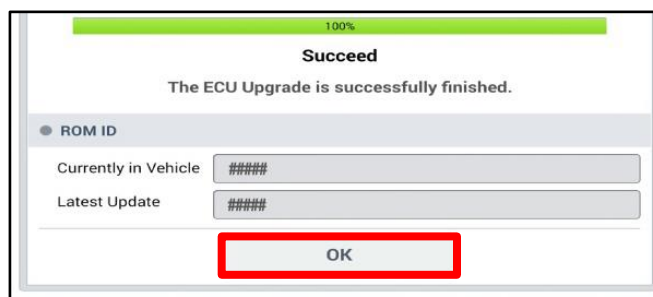


### IMPORTANT

**DO NOT close the pop-up message until last data validation is complete.**

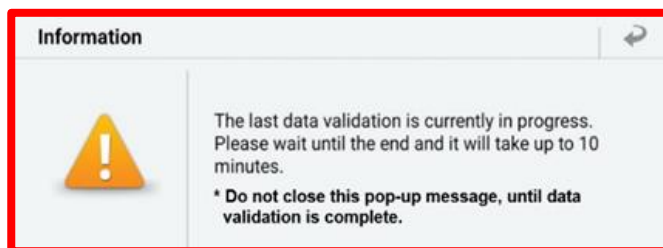

12. When prompted, select 'YES' to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.

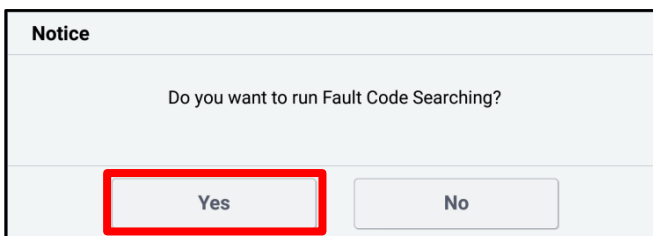

13. Start the engine to confirm normal operation of the vehicle.

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

### Manual Upgrade Procedure:

#### NOTICE

The manual upgrade should ONLY be performed if the automatic upgrade fails.

**If the automatic upgrade fails, turn the ignition 'OFF' for about 10 seconds then place it back in the 'ON' position to reset the control unit BEFORE performing manual upgrade.**

See table below for 'Manual Mode' passwords.

### Manual Mode ECU Upgrade Passwords

Event No.	Menu	Password
<b>#653</b>	SL BCM: 95400-3WLC0/LD0/MC0/MD0	4000
	SL BCM: 95400-3W820/830/920/930	4820
	SL BCM: 95400-3W821/832/921/932	4391
	SL BCM: 95400-3W822/833/922/933	3833
<b>#652</b>	QL BCM: 95400-D9700/710/760/770/EW0/EY0	9516
	QL BCM: 95400-D9701/711/761/771/EW1/EY1	9518
	QL BCM: 954A0-D9AX0/AY0/AZ0/BD0/BE0/BF0	9519
	QL BCM: 954B0-D9AX0/AY0/AZ0/BD0/BE0/BF0	9520

1. Within the ECU Upgrade screen displayed, select **Manual Mode**.
2. Select the **IBU/BCM** system under the System selection menu. Select **Upgrade Event #652 (QL) or #653 (SL)** and select **Upgrade** to continue.
3. Select the appropriate control unit part number with reference to the ROM ID Information Table on page 3, and select **OK**.
4. Enter the appropriate password from the Manual Mode password table above and select **OK**.
5. The upgrade will begin and the progress of the upgrade will appear on the bar graph.
6. When instructed on the KDS, turn the ignition **OFF** for ten (10) seconds then back on. Select **OK**.
7. Once the upgrade is complete, select **OK** to finalize the procedure.
8. When prompted, select **YES** to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.
9. Start the engine to confirm proper operation of the vehicle.

SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

### Decal Installation Procedure:

1. Print this page to 100% scale.
2. Cut-out the template sheet along the black dotted lines.  
(Save the template for future use on other vehicles)



*Continued on page 10.*

Two (2) decals required per vehicle

### ⓘ IMPORTANT

Be sure the door window glass is dust free and clean from any fingerprints or smudges before applying decals to glass surface.

# Sportage (SL/QL)



Rear

Front




SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

- 3a. Confirm that the door glass is completely in the up position.
- 3b. Using masking tape (or similar no-residue tape), adhere the template sheet to the outside of the right passenger, front door glass as shown.

**Note:** Be sure that the template outlined edges are flush against the B-pillar trim corner and bottom inner side and along the bottom door window trim.

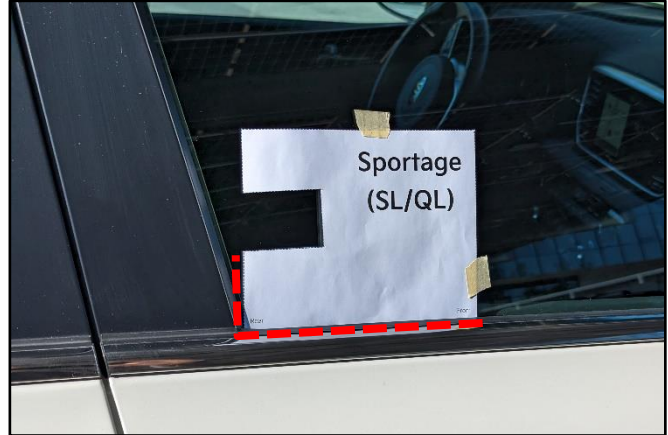

- 4a. Carefully expose leading edge of label adhesive by simultaneously pulling back on liner and pushing leading edge of label forward. **DO NOT TOUCH ADHESIVE.**
- 4b. Once approximately half of the label is removed from the liner, position the label on the INSIDE of the passenger right door window (aligned to template box).



- 5a. From the outside of the vehicle, confirm that the decal is perfectly aligned inside the template box.
- 5b. From the inside, begin to press on the decal in a forward direction (pushing any air bubbles out) until the label is fully applied to the window.



6. Remove the template sheet from the door glass and turn the paper sheet over to prepare for use on the left driver side.
7. Repeat steps 3-5 for the left driver door glass.



SUBJECT:

## CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2302)

### Other things to consider:

#### Vehicles equipped with 'aftermarket' window tint:

Be sure to get the customer's approval to install the 'Kia Anti-Theft Logic' decals if the vehicle has aftermarket window tint installed as they will adhere to the tint film surface and not the door glass surface, and alert customer that the 'Kia Anti-Theft Logic' decals may not be visible through the tint film from outside the vehicle.

#### For 'California' state vehicles only:

The Proposition 65 decal may still be present on the inner front door glass. Be sure to get the customer's approval to remove this decal from the inner door glass before installing the 'Kia Anti-Theft Logic' decals.


### AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sportage (SL)	May 6, 2010 to Nov 16, 2015
Sportage (QL)	Dec 10, 2015 to Dec 7, 2021

### REQUIRED TOOL:

Tool Name	Figure	Comments
KDS		Kia Diagnostic System

### REQUIRED PART:

Part Name	Part Number	Figure	Qty.
'Kia Anti-Theft Logic' Decal*	SO230 ATL		2 (Auto-shipped to dealers in a roll containing 100 qty.)

\*Note: Additional orders may be made through Archway (866) 542-6268. Please track any customers that may require window decals if unavailable at the time of the anti-theft S/W upgrade.

### WARRANTY INFORMATION:

**N Code: N99 C Code: C99**

Claim Type	Model	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	Sportage (SL)	95400 3WLA0	0	<b>(CS2302A)</b> IBU-BCM S/W Logic Upgrade + Decal(s) Installation	CS2302R0	0.3 M/H	N/A	0
	Sportage (QL)	954A0 D9AX0		<b>(CS2302B)</b> IBU-BCM S/W Logic Upgrade + Decal(s) Installation	CS2302R1			

