



Technical Service Bulletin

91 MIB2+: lower display flickering after a software update

91 24 06 2061029/5 May 7, 2024. Supersedes Technical Service Bulletin Group 91 number 21-01 dated May 14, 2021 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, and A7	2019 - 2020	All	MIB2+
A6 allroad, S6, and S7	2020		

Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised header (updated software filter) Revised Service (updated part numbers to match new header) Revised Warranty (updated claiming instructions)
4	05/14/2021	Revised header (Updated vehicle equipment)
3	12/17/2020	Revised Service (Clarified when to use TSB 2053875)

Customer states:

- After a MMI Software update has been completed, the lower display sporadically flickers (Figure 1).



Figure 1. The display sporadically flickers.



Technical Service Bulletin

Technical Background

There are compatibility issues between the display and the MMI software.

Production Solution

New software in the lower MMI display addressed the condition.

Service

Required equipment:

- ODIS Tester.
- SVM Code
- MIB2+ display software update on SD Card (See *Required Parts and Tools* or download the software from the MirrorServer using the SD Creator Program).

Time to complete update:

- Approximately 20-30 minutes (includes 10-20 minutes for the software update, and 10 minutes for the SVM work).

Service work:



NOTICE

The repair described below is only to be performed if the display (address word 0636) has software part number 4K191960[4|5]C and hardware part number 4K191960[4|5] with software version 0141.

- If the display has software part number 4K191960[4|5]C and hardware part number 4K191960[4|5]C with software version 0141, then the update is not necessary and **cannot** be performed.
- For vehicles within the VIN range from *KN000001 to *KN058675 that have a front information display control head, J685 (address word 0636) with part number 4K1.919.605, please refer to TSB 2053875: *91 MIB2: Lower MMI (HVAC) screen image is distorted or flickering* prior to executing this bulletin.

Update the MIB2+ display using Method 2 according to TSB 2056558: *91 MIB2+ Software Update Instructions and use SVM code 636 S002*.

Method 2: Manual update due to SVM code or Server issues.

Vehicle	SD Creator Part Number	SVM Code
A6/A7	4K1906961	636S002



NOTICE



Technical Service Bulletin

Please use the claiming instructions from this TSB, do not use claiming instructions in TSB 2056558.

Warranty

Claim Type:	• 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9193		
Damage Code:	0039		
Labor Operations:	Program display and operating unit	9193 2599	20 TU
	Charge battery	2706 8950	See SRT with associated operations
Diagnostic Time:	GFF	0150 0060	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2061029/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

 
Required Parts and Tools

Model	SD Card	Quantity
A6/A7	4K1906961	01 (Shop tool)

Additional Information

All parts and service references provided in this TSB (**2073865**) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes



Technical Service Bulletin

at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.