



# Technical Service Bulletin

**93 Q5, A7, A8 TFSI: preferred charging time cannot be set, software 1191**

93 24 52 2073891/1 May 10, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A7, S7, A8, and S8	2020 - 2023	All	Not Applicable
A8 e quattro	2020 - 2021		
RS7, Q5, Q5 e quattro, Q5 Sportback, SQ5, and SQ5 Sportback	2021 - 2023		
A7 e quattro	2021 - 2022		

## Condition

### Customer states:

- The preferred charging time function cannot be set.

### Workshop findings:

- The complaint can be reproduced.
- In address **00C6** (High-voltage battery charger), the vehicle has software version number **1191** and one of the following parts numbers listed in the SVM table below.

## Technical Background

Software issue.

## Production Solution

Improved software version: 1192.

## Service

1. VAS tester with the current version of ODIS.



### NOTICE

**Always use DoIP when flashing a control module via ODIS in supported vehicles.**



# Technical Service Bulletin

 
- **Activate DoIP, select *Administration >> General >> GFF Process >> DoIP communication >> Only allow DoIP communication.***
- ***This setting will automatically reset when the diagnostic session has ended. You can tell if DoIP is active by observing a red LED on the VAS 6154(A).***

2. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
3. Update the High-voltage battery charger (J1050) using the SVM action code as listed in the table below, if necessary:

Model	Diagnostic Address	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
Q5 TFSI e	00C6	5QE.915.681.DC	1191	5QE.915.681.EC	1192	C6A013
A7 TFSI e		5QE.915.681.DB		5QE.915.681.EB		
A8 TFSI e		5QE.915.681.DD		5QE.915.681.EA		

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 Up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9352		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software update	0151 0060	Time stated on the diagnostic protocol (Max 50 TU)
	Software update	0151 0010	See SRT and associated operations.
<b>Diagnostic Time:</b>	GFF – Checking and clearing fault codes included in existing labor operations	No allowance	0 TU
	Test drive before the service procedure	No allowance	0 TU
	Test drive after the service procedure	No allowance	0 TU



# Technical Service Bulletin

---

Claim Comment:	As per TSB 2073891/1
----------------	----------------------

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All part and service references provided in this TSB (**20738911**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.