



Analysis Worksheet	
Topic	Oil leaking from cylinder head cover bolts
Model(s) affected	MY 21-23 Q5 Engine code: DPVA
Documentation needed	<ul style="list-style-type: none"> Leak is present as described in TSB 2072716 Vehicle applies to TSB 2072716 No previous repairs made to the cylinder head cover Take detailed photos of the leaking bolts. Do not clean or make any repairs to the cylinder head cover. Contact TAC for further direction
Questions	
Other information: <small>(Please include any other useful information from the customer or found during diagnosis.)</small>	
Note:	<ul style="list-style-type: none"> Information requested in these worksheets update frequently. Please always use the latest worksheet on Elsa2go. Please include all information requested in the worksheet up front when submitting the WEB ticket to TAC.