



SIB 65 17 24

2024-07-08

MALFUNCTION WHEN PAIRING THE MAIN DIGITAL KEY (HU-H5)

☒ THIS REPAIR IS MOBILE FRIENDLY**MODEL**

E-Series	Model Description	Affected Option Code
G20	3 Series Sedan	With: SA 322 – Comfort Access SA 6AE – Teleservices
G22	4 Series Coupe	
G23	4 Series Convertible	
G26	4 Series Gran Coupe	
G82	M4 Coupe	
G83	M4 Convertible	

Only for vehicles with **Head Unit 5** (HU-H5)

SITUATION

It is not possible to complete the setup of the BMW Digital Key function in the vehicle with a smartphone.

The main digital key cannot be paired using the My BMW App. The digital key pairing process does not respond after the message “Please place your smartphone on the NFC tray” appears in the Central Information Display (CID).

No function is available with the NFC (near-field communication) card either.

CAUSE

Unfavorable software in the head unit (HU-H5).

CORRECTION

Program the head unit (HU-H5).

PROCEDURE

Determine the vehicle's current I-level by either using AIR or the Key Reader/AWP (Aftersales Workplace) applications.

If the I-Level is currently at S18A-24-07-525 or a more recent version:

- Do not program the vehicle
- Continue with standard diagnosis

If the I-level is lower than S18A-24-07-525:

Program the vehicle to I-level S18A-24-07-525 or higher using ISTA 4.48.1x (released June 25, 2024) or higher.

- Connect the battery charger to the vehicle
- Connect the programming system to the vehicle (ISTA 4)
- Determine measures plan
- Accept and fully work through the measures plan with the control units to be programmed/encoded and enabled
- Follow the rework list
- **Depending on the rework list, carry out a vehicle test and delete the fault memory if needed**

After the programming has been fully completed, check functionality of the system.

Copyright ©2024 BMW of North America, Inc.

Note: ISTA will automatically reprogram and code all programmable control modules that do not have the latest software.

Always connect a BMW-approved battery charger/power supply (SI B04 23 10).

For information on programming and coding with ISTA, refer to Dealer Universal Portal / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

CLAIM INFORMATION

Vehicle Programming and Encoding

During this workshop visit, the affected vehicle may show one or more programming and encoding Technical Campaign repairs open, the programming and encoding procedure may only be invoiced one time.

Select one of these open Technical Campaigns to perform and submit for updating the vehicle to the required I-level, or higher when applicable (Includes labor operation codes 00 00 006/556, 61 21 528 and 61 00 730).

Please be sure to perform any additional before and/or after work (including attaching labels) as required by the open campaigns on the vehicle. Close any remaining open programming and encoding Campaign repairs as outlined in the corresponding Service Information Bulletin.

Only if the above situation does not apply, the BMW software solution is then covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks, or the BMW Certified Pre-Owned Program as described below.

Repair Code:	6512580200	Headunit High HU-H Software error / internal device fault
---------------------	-------------------	--

Obtain the flat rate unit (FRU) allowances for the following that applies.

Labor Operation	Description	Labor Allowance
00 00 006	Carrying out vehicle test (Main work)	As applicable
Or:		
00 00 556	Carrying out vehicle test (Plus work)	As applicable
And:		
61 21 528	Supporting voltage of the vehicle electrical system / recharging vehicle battery	As applicable
And, as necessary:		
61 00 006*	Performing vehicle diagnosis – test module (Work time)	WT
Or		
00 58 500*	Diagnosis Worktime Flat Rate (See below)	2 FRU
And		
61 00 730	Programming/encoding control unit(s)	As applicable

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006, or exclude (including 61 21 528) when the Vehicle Test is included in another repair.

Work time labor operation codes 61 00 006 and 00 58 500 are not considered Main labor operations.

BMW Group's AIR Application Resource for Flat Rate Labor Operation Codes

To obtain the corresponding flat rate unit (FRU) allowance information from the BMW Group AIR application resource, start by entering the Chassis Number, which consists of the last seven (7) characters of the VIN. Click on the "Search" button, and then enter the applicable flat rate labor operation in the FR code field.

Vehicle Programming and Encoding – Additional Work (RO and Claim Comments Required)

This procedure automatically reprograms and encodes any vehicle control modules that do not have the latest software I-level.

If one or more control modules fail during the reprogramming procedure, claim the required consequential repair work procedures to address this issue (including performing the IRAP Control Unit Recovery first as required, refer to the SIB in AIR) under the Repair Code in this bulletin together with the corresponding labor operation codes and their flat rate unit (FRU) allowance(s), including the diagnosis* that applies.

Please explain the additional work procedures that were performed (The why and the what) on the repair order and in the claim comments.

For covered repairs that address control module failures that occurred prior to performing this reprogramming procedure, claim this work with the applicable Repair Code listed in AIR together with the corresponding labor operation codes and their flat rate unit (FRU) allowance(s), including the diagnosis* that applies.

(*) Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for the applicable procedure for documenting, claiming, and explaining, on the RO and in the claim comments, your diagnosis work time (WT), job/repair work time (WT), and the vehicle repairs your center performed, unless otherwise required by State law.

BMW Group’s AIR Application Resource for Flat Rate Labor Operation Codes

To obtain the corresponding flat rate unit (FRU) allowance information from the BMW Group AIR application resource, start by entering the the Chassis Number (last seven (7) characters of the VIN), and click on the “Search” icon. If the “Vehicle Selection” window displays two or more model possible vehicle choices, select the applicable Model, or enter the full VIN (17 characters) instead to proceed. Click on the “Flat Rate Units” button and enter a flat rate labor operation code number “without spaces” in the field to the right, click on the “Search” icon to display the corresponding listing of “Flat rate unit group details” that are available and their corresponding FRU allowances.

Other Repairs

If other eligible and covered work is performed because of performing the ISTA diagnostics, related test plans, and/or other approved diagnosis procedures, claim this work with the applicable Repair Code listed in AIR together with the corresponding labor operation codes and their flat rate unit (FRU) allowance(s), including the diagnosis* that applies.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

