

TECHNICAL SERVICE BULLETIN



DEPARTMENT OF COMPLIANCE
VEHICLE SAFETY AND RECALL MANAGEMENT
PO Box 30
MIDDLEBURY, INDIANA 46540-9218

Technical Service Bulletin: 205-1815

- o Integrity
- o Safety
- o Quality
- o Customer Service

<<VIN>>
<<OWNER NAME/DEALERNAME>>
<<ADDRESS>>
<<CITY>>, <<ST>> <<ZIP-XXX>>

July 2024

This Notice applies to your vehicle VIN listed above.

Dear Forest River Customer:

Forest River is alerting you to an issue involving certain 2025 Catalina ACAT263FKDSLE, ACAT293TQBSCCKLE, ACAT323BHDSCCKLE, and ACAT333FKTSLE Travel Trailer Recreational Vehicles. Please see the information below, which describes the issue and provides you with details on the steps you should take to have your vehicle repaired.

WHAT IS THE ISSUE?

The radio antenna is not hooked up correctly.

DEALERS: WHAT SHOULD YOU DO?

Remedy Instructions can be found on Dealer Connect.

HELPFUL CONTACT INFORMATION:

CONTACT	PHONE
CATALINA CUSTOMER SERVICE	(574) 825-4995

DEALER REPAIR CODES: Dealer Connect

PRIOR AUTHORIZATION IS REQUIRED

TSB NUMBER	REPAIR CODE	DESCRIPTION	ALLOWABLE HOUR(S)
205-1815	SB-400-09-11-004587	PERFORM REMEDY	1.0 HRS

WHAT IF YOU HAVE PREVIOUSLY PAID FOR REPAIRS TO YOUR VEHICLE FOR THIS PARTICULAR CONDITION?

If you have already paid for a repair that is within the scope of this service bulletin, you may be eligible for a refund of previously paid repairs. Refunds will only be provided within the scope of this Technical Service Bulletin.


Please send the service invoice to the following address:

Catalina
Forest River, Inc.
Attn: WARRANTY MANAGER
423 N Main St
Middlebury, IN 46540

Sincerely,

Forest River, Inc.
Office of Corporate Compliance

TECHNICAL SERVICE BULLETIN 205-1815 REMEDY INSTRUCTIONS

	Make(s): CATALINA Model(s): SEE BELOW Model Year(s): 2025	Repair Code: SB-400-09-11-004587 Allotted Time: 1.00 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The radio antenna may not have been hooked up correctly.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Number: N/A Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

2025 Catalina ACAT263FKDSLE, ACAT293TQBCKLE, ACAT323BHDCKLE, ACAT333FKTSLE

SOURCE LOCALLY:

- 1 – 2-WAY SPLITTER FOR COAX CABLE
- 1 – 16" COAX CABLE, COMPLETE WITH ENDS
- 1 – RADIO ANTENNA WIRE, WITH ANTENNA PLUG ON ONE END AND COAX CABLE ON OTHER END

- STEP 1: REMOVE BOOSTER BOX & RADIO;
- STEP 2: REMOVE THE CURRENT WHITE COAX CABLE FROM THE BOOSTER, INSTALL TO THE SPLITTER **INPUT**;
- STEP 3: TAKE THE NEW 16" COAX AND HOOK TO THE SPLITTER **OUTPUT**, THEN TO THE BOOSTER;
- STEP 4: INSTALL NEW RADIO ANTENNA WIRE WITH COAX END TO THE OTHER **OUTPUT** OF THE SPLITTER;
- STEP 5: UNPLUG THE RADIO ANTENNA FROM THE REAR OF THE RADIO, THIS IS A DEAD WIRE. LEAVE IT BE;
- STEP 6: PLUG IN THE NEW RADIO ANTENNA WIRE FROM THE SPLITTER INTO THE REAR OF THE RADIO;
- STEP 7: REINSTALL BOOSTER;
- STEP 8: REINSTALL RADIO;
- STEP 9: TEST FUNCTIONALITY;
- STEP 10: CLAIM REPAIR CODE.