

MAS004300 RU 24-22

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 733 Grecale - BSM Software Update

TECHNICAL SERVICE OPERATIONS



DATE: JULY 22, 2024

Certain Maserati Grecale (M182) MY23 MY24 MY25 listed in MODISCS+ are involved in a Rapid Update to update the BSM (Braking System Module) software.

This action is necessary to prevent the potential appearance of multiple warning lights on the instrument cluster during the initial key-on. In rare cases, a firmer brake pedal feel may occur.

However, even if the brake pedal feels firmer, the overall performance of the brake system ensures that the stopping distance still meets local homologation requirements.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure the following preconditions:
 - a. Battery voltage > 12,5 V (It is suggested to connect the 12V Battery to Battery Maintainer)
 - b. Key ON and Engine OFF
 - c. Vehicle in standstill
 - d. SGW unlocked
3. Using MD-Evo, perform **BSM – ECU Programming**.

Software version to be installed (or newer).

Market	Engine	F187	F18B	F18A	F191
ROW	MHEV	670219050 670303932	670353222	670353223	670181783
	V6 TROFEO	670219051 670303933	670353222	670353223	670181783

4. After ECU Programming, perform **BSM – Procedures – Post-flash Operations**.
5. After Post-flash Operations, perform **BCM – Procedures – PROXI Alignment**.
6. Clear ANY residual DTCs.
7. Procedure complete.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	733
Warranty Code	23
Fault Code	063
Component Code	4.90.002
Operation Code	4.90.002.A (0,20h)