

MAS004322 RU 24-24

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 734 GT GC - BSM Software Update

TECHNICAL SERVICE OPERATIONS



DATE: July 31, 2024

Certain Maserati GranTurismo and GranCabrio (M189) MY24 MY25 listed in MODISCS+ are involved in a Rapid Update to update the BSM (Braking System Module) software.

This action is necessary to prevent the potential appearance of multiple warning lights on the instrument cluster during the initial key-on. In rare cases, a firmer brake pedal feel may occur.

However, even if the brake pedal feels firmer, the overall performance of the brake system ensures that the stopping distance still meets local homologation requirements.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
3. Before proceeding, please ensure that the Key is ON, but the Engine is OFF.
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **BSM**
▶ **ECU Programming** and follow the prompts.

Software version to be installed (or newer).

Market	F18B	F18A
ROW	670353222	670353223

5. After ECU Programming, perform **BSM – Procedures – Post-flash Operations**.
6. After Post-flash operations, perform **BCM – Procedures – PROXI Alignment**.
7. Clear ANY residual DTCs.
8. Procedure complete.

Warranty Claim

Fill in the Warranty Claims as follows:

Description	Code
Rapid Update Number	734
Warranty Code	23
Fault Code	063
Component Code	4.90.002
Operation Code	4.90.002.A (0,20h)