

Technical Service
Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: FRONT AND REAR BRAKE NOISE	Bulletin No.: 04-003/24
	Last Issued : 07/09/2024

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below.

Previous TSBs:	Date(s) Issued:	Previous TSBs:	Date(s) Issued:
04-001/23	09/13/23, 02/13/23, 01/04/23	04-001/22	03/24/22
04-004/22	11/29/22	04-003/20	02/20/20
04-002/22	06/09/22 and 04/19/22		

APPLICABLE MODEL(S)/VINS:

2013-2025 CX-5

DESCRIPTION

Front Brake Noise Symptom 1: Some vehicles may exhibit a click noise when first moving forward or reverse from a stop OR when first applying the brakes while moving forward at slow speeds. This is caused by deteriorated grease between the brake pads and the shim, the front brake pads move upward/downward along with the brake rotors during brake application. When the vehicle moves or the brakes are applied the next time, the front brake pads move to the other side, which causes a click noise.

Front Brake Noise Symptom 2: Some vehicles may exhibit the brakes having an unusual noise or vibration when applying the brake. This is caused by rust on the brake disk plate's surface.

Rear Brake Noise Symptom 1: Some vehicles may exhibit a squeak noise from the rear brakes while braking lightly and occurs more frequently when driving at slow speeds. The noise is caused by poor contact between the guide plate and the mounting support. To eliminate this concern, the material of the pads has been changed to copper-free and the specification of the shims has been changed to a coated spring with tape.

Rear Brake Noise Symptom 2: Some vehicles equipped with an electric parking brake (EPB) may exhibit a grinding noise from the rear brakes when braking. This may be caused by the rear brake pads not having the capability to remove the rust from the rear brake discs. The red rust accumulated on the discs is exposed to high temperatures during braking, and consequently the rust turns black. As the black rust is too hard to be removed by the brake pads, the rust progress is accelerated, resulting in the grinding noise.

Customers having this concern should have their vehicle repaired using the following repair procedure.

Page 1 of 6

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

NOTE:

- The material of the brake pads has been changed to copper-free and the specification of the shims has been changed to a coated spring with tape.
- Refer to SA-016/24 - (BRAKE NOISE, JUDDER AND DRAGGING DIAGNOSIS AND SERVICING) if brake noise continues after repair is completed (front and rear).

REPAIR PROCEDURE**Front Brake Repair Procedure:**

1. Verify the customer concern.
2. Check the disc surface to see if the cause of noise and vibration is the disc's rust (Some areas of the surface have fallen off due to rust and are thinned, which may look like black stains on the surface). If rust is the cause of the noise or vibration when applying the brake, lathe disks on-vehicle using an on-car brake lathe or off-car brake lathe, or replace them with new ones and replace the brake pads.

NOTE: Check the disc thickness using a micrometer before lathing, if the thickness is less than 27.6mm, replace the disc (DO NOT lathe using an on-car brake lathe or with an off-car brake lathe. Measure the thickness in the relatively less rusted area where the pads are hitting but not in the severely rusted area.

3. After lathing the disc, re-measure the disc thickness. Replace the discs if the thickness is below the machining limit of 26.8 mm as well as the brake pads. Refer to the instructions in MGSS:

- FRONT BRAKE DISC PAD REMOVAL/INSTALLATION [WITH SINGLE PISTON FLOATING CALIPER]
- FRONT BRAKE DISC PAD REMOVAL/INSTALLATION [WITH 2-PISTON FLOATING CALIPER]
- FRONT BRAKE DISC REMOVAL/INSTALLATION [WITH SINGLE PISTON FLOATING CALIPER]
- FRONT BRAKE DISC REMOVAL/INSTALLATION [WITH 2-PISTON FLOATING CALIPER]

4. Verify the repair.

NOTE: Refer to SA-016/24 - (BRAKE NOISE, JUDDER AND DRAGGING DIAGNOSIS AND SERVICING) if brake noise continues after repair is completed.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Rear Brake Repair Procedure:


1. Verify the customer concern.
2. Check the disc surface to see if the cause of noise and vibration is the disc's rust (Some areas of the surface have fallen off due to rust and are thinned, which may look like black stains on the surface).

NOTE:

- If rust is the cause of the noise or vibration when applying the brake, lathe disks on-vehicle using an on-car brake lathe or off-car brake lathe, or replace them with new ones and replace the brake pads.
- If brake discs DO NOT have rust, check the disc thickness using a micrometer before lathing, refer to the instructions in MGSS:
 - REAR BRAKE INSPECTION
 - REAR BRAKE DISC PAD REMOVAL/INSTALLATION
 - REAR BRAKE DISC REMOVAL/INSTALLATION

NOTE:

- Verify if the tape is installed to both guide plates (some kits do not have the tape installed and is packaged separately).
- If the tape is not applied to the guide plates, peel off the red release film (1) and the dual adhesive tape (2) from the release paper (3) and apply the dual adhesive tape to the contact surfaces of the guide plates as shown below.

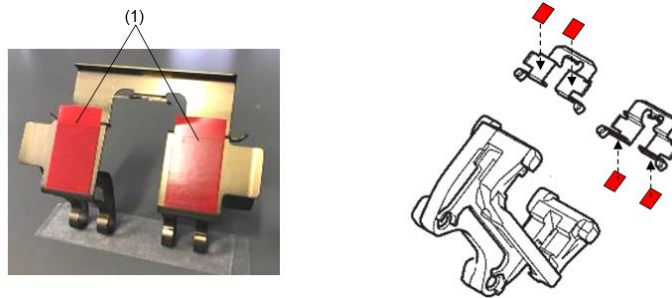

NOTE: Red adhesive tape is only supplied for the rear brakes.

4. Verify the repair.

NOTE: Refer to SA-016/24 - (BRAKE NOISE, JUDDER AND DRAGGING DIAGNOSIS AND SERVICING) if brake noise continues after repair is completed.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Model Year	Part Number	Description	Qty.	Notes
2013- 2025 CX-5	KGY0-33-28Z	PAD SUB SET, FRONT CALIPER (W/O TURBO)	1	--
	K0Y1-33-29Z	ATTACHMENT (SHIMS), PAD-FRONT (W/O TURBO)	1	--
	TAY0-33-28Z	PAD SUB SET, FRONT CALIPER (W/ TURBO)	1	--
	L2Y6-33-29Z	ATTACHMENT (SHIMS), PAD-FRONT (W/ TURBO)	1	--
	KD45-33-251	FRONT PLATE DISC (W/O TURBO)	0 or 2	--
	TK78-33-251B	FRONT PLATE DISC (W/ TURBO)	0 or 2	--
2018 CX-5 (Diesel)	TKY8-33-28ZB	PAD SUB SET, FRONT CALIPER (DIESEL)	1	--
	L2Y6-33-29Z	ATTACHMENT (SHIMS), PAD-FRONT (DIESEL)	1	--
2013- 2025 CX-5	KBY6-26-43Z	PAD SET, REAR CALIPER	1	With Attachments (Shims)
	K011-26-251C	REAR PLATE DISC	0 or 2	--

NOTE: If KBY6-26-43Z is unavailable to order, then the combination of KBY6-26-48Z and KBY6-26-49Z can be used in it's place.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term (if vehicle contains OE or Genuine Mazda brake pads/rotors).
- Additional diagnostic time cannot be claimed for this repair.

Front Brakes	
Warranty Type	A
Symptom Code	83
Damage Code	9Y
Part Number Main Cause	7777-SP-W18
Quantity	0
Operation Number / Labor Hours:	Discs and pads/attachments replacement - XXW53XRX / 0.5 Hrs. (For both sides) Discs lathe, and pads/attachments replacement - XXW54XRT / Enter actual time (Max. 1.2 Hrs. for both sides) Discs lathe, and discs and pads/attachments replacement - XXW55XRT / Enter actual time (Max. 1.2 Hrs. for both sides).

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Rear Brakes

Warranty Type	A
Symptom Code	53
Damage Code	9Y
Part Number Main Cause	7777-SP-S18
Quantity	0
Operation Number / Labor Hours:	Pad Set Replacement (Both Sides) AND Brake Disc Replacement (Both Sides) YY833XRX / 0.6 Hrs. (*1) Discs lathe, and pads/attachments replacement AND Discs lathe, and discs and pads/attachments replacement YY834XRT / Enter actual time (Max. 1.2 Hrs. for both sides).

*1: Submit an applicable labor time by referring to the SRT manual.

NOTE: All replaced parts are to be claimed as related parts.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.