



## **SSM 52738 2021-2024 Bronco/F-150 - "Check Charging System" Message In The IPC Due To Aftermarket Programming**

Some 2021-2024 Bronco/F-150 (non-Lightning) vehicles may exhibit a "Check Charging System" message in the instrument panel cluster (IPC) while the charging system is fully operational and there are no diagnostic trouble codes (DTC) stored related to the charging system. This may be due to the customer using an aftermarket programmer to change body control module (BCM) configuration. To correct this condition, download and run the Ford Diagnosis and Repair System (FDRS) application titled "BCM-Charging System Configuration Correction". Running this application will determine if the BCM configuration was modified by the customer and if so, provide the option to return the configuration back to factory settings. Advise the customer that returning the configuration back to the factory setting will reactivate the auto start/stop feature on the vehicle. This repair is not warrantable.