



Technical Service Bulletin

57 "Vehicle Lighting" warning message displayed in instrument cluster

57 24 48 2074172/1 July 2, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, RS 5, RS 5 Sportback, e-tron GT, RS e-tron GT, Q7, SQ7, Q8, SQ8, and RS Q8	2023 - 2024	All	Not Applicable

Condition

Customer states:

The following message appears **permanently** in the instrument cluster: **“Vehicle lights: fault. Please contact workshop”**. There are no functional issues. The lights work.

Workshop findings:

An event memory entry about the vehicle lights is **not** logged in any of the control units. The instrument cluster message appears permanently.

Technical Background

Software issue in Comfort System Central Control Module, -J393- (address word 0046).

Production Solution

Optimized software version 0630 of Comfort System Central Control Module, -J393- (address word 0046) has been implemented in current series production.

Service

This TSB only applies if the message appears permanently in the instrument cluster and there are no relevant event memory entries relating to the lights.





Technical Service Bulletin

Tip: Prior to performing this SVM Update, please inform the customer that if the virtual pedal was deactivated from a prior TSB:2070966, the changes will be lost and must be reperformed. It is not possible to remotely store their settings.

Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*. Update the J393 (0046) using the SVM action code as listed in the table below, if necessary:

NOTICE

The Key must be on the emergency reader coil during the update.

Model	Diagnostic Address	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
A4, A5, Q7, and Q8	0046	8W1.907.064.*	0627, 0628	8W1.907.064.*	0630	46A034
e-tron GT	0046	992.907.064.*	0627, 0628	992.907.064.*	0630	46A034

Once the update is complete, reset the Comfort System Central Control Module, -J393- (address word 0046) for at least 10 minutes. To do this, pull the fuses for the -J393- according to the current wiring diagram in the ELSA repair manual.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 Up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	5789		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0010	See SRT with associated operations
	Reset of the Comfort System Control Module	5789 0599	10 TU



Technical Service Bulletin

Diagnostic Time:	Software Update	0151 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2074172/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2074172**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.