



Technical Service Bulletin

93 e-tron GT P0DAC00 in 8c - unnecessary module replacement after repair

93 24 65 2074056/1 July 1, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 - 2024	All	Not Applicable

Condition

Workshop findings:

The following issue occurs after a repair was performed during which the 12 V battery was disconnected and reconnected.

1. Event memory entry: P0DAC00: Hybrid/HV battery cell controller 1 electrical fault (static/intermittent).
2. Guided Fault Finding recommends replacing one or more high-voltage battery modules.

Technical Background

When connecting the 12V battery, the current may be interrupted for short periods, resulting in CMCs being logged in the self-test. ODIS then suggests replacing the module. This is unnecessary, as the modules are not defective.

Production Solution

Not applicable.

Service

Create a TAC ticket and identify it as **“Reporting obligation according to the Technical Service Handbook”**. Use the workshop code: **Energy, electrical system, data transfer → battery management → de-energization**.

We reserve the right to only pay out for warranty claims after thorough checks if a reporting obligation is not observed. We apologize for any inconvenience caused if delays in processing occur as a result.

Complaints already covered by a TSB in HST (ELSA) are exempt from this reporting obligation.

Please postpone all repairs and send a support request.

To reset the event memory entry, we must access your vehicle remotely using an external program.



Technical Service Bulletin

Please contact your support to receive it.



In the TAC ticket, use as the subject the TSB number and the phrase “Remote session P0DAC00”.

The support team will provide you with the next steps.

On behalf of AUDI AG, thank you for your assistance.

Warranty

There is no reason to replace parts or attempt repairs. Unjustified work/replacement parts will be charged back.

Additional Information

All part and service references provided in this TSB (**2074056**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.